



SAMHAXExxA-B Errata

SAMHAXExxA

The SAMHAXExxA family of devices that you have received conform functionally to the current Device Data Sheet (DS20005902B), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#).

The errata described in this document will be addressed in future revisions of the SAMHAXExxA family silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

Data Sheet clarifications and corrections (if applicable) are located in [Data Sheet Clarifications](#), following the discussion of silicon issues.

Table 1. SAM HAX Family Silicon Device Identification

Part Number	Device Identification (DID[31:0])	Revision (DID.REVISION[3:0])
		F
ATSAMHA1E16A-B	0x10011583	0x5
ATSAMHA1E15A-B	0x10011584	
ATSAMHA1E14A-B	0x10011585	
ATSAMHA0E16A-B	0x1001158F	
ATSAMHA0E15A-B	0x10011590	
ATSAMHA0E14A-B	0x10011591	

Note: Refer to the “Device Service Unit” chapter in the current Device Data Sheet (DS20005902B) for detailed information on Device Identification and Revision IDs for your specific device.

Silicon Errata Summary

Table 2. Errata Summary

Module	Feature	Item Number	Issue Summary	Affected Revisions
				F
XOSC32K	Automatic Gain Control	1.1.1	The automatic amplitude control of the XOSC32K does not work.	X
XOSC32K	External Reset	1.1.2	If the external XOSC32K fails, the external reset will not reset the GCLKs sourced by the XOSC32K.	X
DFLL48M	Write Access to DFLL Register	1.2.1	The DFLL clock must be requested before being configured.	X
DFLL48M	False Out of Bound Interrupt	1.2.2	If the DFLL48M reaches the maximum or minimum COARSE or FINE calibration values during the locking sequence, an out of bounds interrupt will be generated.	X
DFLL48M	DFLL Status Bits (PCLKSR Register)	1.2.3	The DFLL status bits in the PCLKSR register during the USB Clock Recovery mode can be incorrect after a USB suspend state.	X

.....continued

Module	Feature	Item Number	Issue Summary	Affected Revisions
				F
FDPLL	DPLLRTIO Register FDPLL Ratio Value	1.3.1	When FDPLL ratio value in the DPLLRTIO register is changed on the fly, STATUS.DPLLDRTO will not be set even though the ratio is updated.	X
ADC	Offset correction	1.4.1	Offset correction is not supported in the 8-bit and 10-bit conversion resolution.	X
DEVICE	APB Clock	1.5.1	If APB clock is stopped and the GCLK is running, APB read access to read-synchronized registers will freeze the system.	X
DEVICE	SYSTICK Calibration Value	1.5.2	The SYSTICK calibration value specified in the data sheet is incorrect.	X
DEVICE	Standby Entry	1.5.3	Potential device lockup upon standby entry when Systick interrupt is enabled.	X
DEVICE	Standby Wake-up	1.5.4	Potential lockup on standby wakeup with interrupts disabled.	X
DAC	EMPTY Flag is Set When Leaving Standby Mode	1.6.1	DAC.INTFLAG.EMPTY will be set after exiting Sleep mode.	X
DMAC	Consecutive Write Instructions to CRCDATAIN	1.7.1	If data is written to CRCDATAIN in two consecutive instructions, the CRC computation may be incorrect.	X
DMAC	Linked Descriptors	1.7.2	When at least one channel using linked descriptors is already active, enabling another DMA channel can result in a channel Fetch Error or an incorrect descriptor fetch.	X
DSU	Pause-on-Error is Not Functional	1.8.1	The MBIST Pause-on-Error feature is not functional.	X
EIC	Interrupts	1.9.1	When the EIC is configured to generate an interrupt on a low level or rising edge or both edges with the filter enabled, a spurious flag may appear.	X
NVMCTRL	Spurious Writes	1.10.1	The default value of MANW in NVM.CTRLB is '0', which can lead to spurious writes to the NVM.	X
NVMCTRL	RWW NVM Command	1.10.2	Incorrect data fetch after RWW NVM command	X
PORT - I/O Pin Controller	Write Protect	1.11.1	Non-debugger IOBUS writes to PAC Write-Protected registers are not prevented when the PORT is PAC Write-protected.	X
SERCOM	USART in Auto-Baud Mode	1.12.1	In USART Auto-Baud mode, missing stop bits are not recognized as inconsistent sync (ISF) or framing (FERR) errors.	X
SERCOM	NACK and Repeated Start in I ² C Host Mode	1.12.2	For High-Speed Host Read operations, sending a NACK forces a STOP to be issued making repeated start not possible in that mode.	X
SERCOM	SERCOM-USART: Collision Detection	1.12.3	In USART operating mode with Collision Detection enabled, the SERCOM will not abort the current transfer as expected if a collision is detected.	X
SERCOM	SERCOM-USART: USART in Debug Mode	1.12.4	In USART operating mode, if DBGCTRL.DBGSTOP = '1', data transmission is not halted after entering Debug mode.	X
SERCOM	SERCOM-I ² C: Client Mode with DMA	1.12.5	In I ² C Client Transmitter mode, at the reception of a NACK, if there is still data to be sent in the DMA buffer, the DMA will push data to the DATA register.	X
SERCOM	SERCOM-I ² C: I ² C Mode in 10-bit Address	1.12.6	10-bit addressing in I ² C Client mode is not functional.	X
SERCOM	SERCOM-SPI: Data Preload	1.12.7	In SPI Client mode and with Client Data Preload Enabled, the first data sent from the client will be a dummy byte.	X
SERCOM	CLKHOLD Bit Status in I ² C	1.12.8	STATUS.CLKHOLD bit can be written whereas it is a read-only status bit in both Host and Client modes.	X
SERCOM	Quick Command I ² C	1.12.9	When Quick command is enabled (CTRLB.QCEN = '1'), the software can issue a repeated Start by either writing CTRLB.CMD or ADDR.ADDR bitfields. If in these conditions, SCL Stretch Mode is CTRLA.SCLSM = '1', a bus error will be generated.	X
SERCOM	Repeated Start I ² C	1.12.10	For High-Speed Host Write operations, writing CTRLB.CMD = 0x1 issues a STOP command instead of a Repeated Start making repeated start not possible in that mode.	X
SERCOM	Client Mode I ² C	1.12.11	In Client mode, BUSERR, COLL, LOWTOUT, SEXTTOUT and LENERR STATUS register bits are not automatically cleared when INTFLAG.AMATCH is cleared.	X
SERCOM	Software Reset	1.12.12	Software Reset (CTRLA.SWRST=1) is not functional when the SERCOM is not enabled (CTRLA.ENABLE=0).	X

.....continued

Module	Feature	Item Number	Issue Summary	Affected Revisions
				F
TCC	CAPTMARK is Not Functional	1.13.1	FCTRLX.CAPTURE[CAPTMARK] does not function as described in the data sheet.	X
TCC	Advance Capture Mode	1.13.2	Advance capture mode does not work.	X
TCC	MAX Capture Mode	1.13.3	In Capture mode while using MAX Capture mode, with the Timer set in up counting mode, if an input event occurred within two cycles before TOP, the value captured is '0' instead of TOP.	X
TCC	Dithering Mode	1.13.4	Using TCC in Dithering mode with external retrigger events can lead to an unexpected stretch of right-aligned pulses or a shrink of left-aligned pulses.	X
TCC	PATTB	1.13.5	The PATTB register write will not update the PATT register on an update condition.	X
TCC	PERBUF	1.13.6	In downcounting mode, the Lock Update bit (CTRLB.LUPD) does not protect against a PER register update from the PERBUF register.	X
TCC	TCC with EVSYS in SYNC/ RESYNC Mode	1.13.7	TCC Peripheral is not compatible with an EVSYS channel in SYNC or RESYNC Mode.	X
TCC	Prescale	1.13.8	A DMA transfer to the TCC CC register may not initiate when using the TCC MCx as the trigger source (CTRLB.TRIGSRC) and the TCC Prescale (CTRLA.PRESCALE) value is set to 64/256/1024.	X
TC	TC with EVSYS in SYNC/ RESYNC Mode	1.14.1	TC peripheral is not compatible with an EVSYS channel in SYNC or RESYNC mode.	X
SYSCTRL	XOSC	1.15.1	The XOSC can prevent entry into Standby mode regardless of XOSC.RUNSTDBY value.	X
SYSCTRL	BOD33 interrupts	1.15.2	The BOD33 interrupt may not be generated second time if VDDANA does not increase above the user-defined threshold (BOD.LEVEL[5:0]) while in Active mode.	X
SYSCTRL	BOD33 hysteresis	1.15.3	The BOD33 hysteresis may not work if other reset sources are active.	X

Table of Contents

SAMHAXEXxA.....	1
Silicon Errata Summary.....	1
1. SAMHAXEXxA.....	5
1.1. 32.768 kHz Crystal Oscillator (XOSC32K).....	5
1.2. 48 MHz Digital Frequency-Locked Loop (DFLL48M).....	5
1.3. 96 MHz Fractional Digital Phase-Locked Loop (FDPLL).....	6
1.4. ADC.....	6
1.5. Device.....	7
1.6. Digital-to-Analog Controller (DAC).....	8
1.7. Direct Memory Access Controller (DMAC).....	8
1.8. Device Service Unit (DSU).....	9
1.9. External Interrupt Controller (EIC).....	9
1.10. Non-Volatile Memory Controller (NVMCTRL).....	10
1.11. PORT - I/O Pin Controller.....	10
1.12. Serial Communication Interface (SERCOM).....	11
1.13. Timer/Counter for Control Applications (TCC).....	14
1.14. Timer/Counter (TC).....	16
1.15. SYSCTRL.....	16
2. Data Sheet Clarifications.....	18
3. Appendix A: Revision History.....	19
Microchip Information.....	20
The Microchip Website.....	20
Product Change Notification Service.....	20
Customer Support.....	20
Microchip Devices Code Protection Feature.....	20
Legal Notice.....	20
Trademarks.....	21
Quality Management System.....	22
Worldwide Sales and Service.....	23

1. SAMHAXExxA

The device variant (last letter of the ordering number) is independent of the die revision (DSU.DID.REVISION): the device variant denotes functional differences, whereas the die revision marks evolution of the die.

1.1 32.768 kHz Crystal Oscillator (XOSC32K)

1.1.1 Automatic Gain Control

The automatic amplitude control of the XOSC32K does not work.

Work Around

Use the XOSC32K with Automatic Amplitude control disabled (XOSC32K.AAMPEN = 0).

Affected Silicon Revisions

F

X

1.1.2 External Reset

If the external XOSC32K fails, neither the external pin RST, nor the GCLK software reset can reset the GCLK generators using XOSC32K as the source clock.

Work Around

Do a power cycle to reset the GCLK generators after an external XOSC32K failure.

Affected Silicon Revisions

F

X

1.2 48 MHz Digital Frequency-Locked Loop (DFLL48M)

1.2.1 Write Access to DFLL Register

The DFLL clock must be requested before being configured; otherwise, a write access to a DFLL register can freeze the device.

Work Around

Write a '0' to the DFLL ONDEMAND bit in the DFLLCTRL register before configuring the DFLL module.

Affected Silicon Revisions

F

X

1.2.2 False Out of Bound Interrupt

If the DFLL48M reaches the maximum or minimum COARSE or FINE calibration values during the locking sequence, an out of bounds interrupt will be generated. These interrupts will be generated even if the final calibration values at DFLL48M lock are not at maximum or minimum, and therefore, may be false out of bounds interrupts.

Work Around

Enable the DFLL out of bounds (DFLLOOB) interrupt when configuring the DFLL in closed loop mode. In the DFLLOOB ISR verify the COARSE and FINE calibration bits and process as needed.

Affected Silicon Revisions

F

X

1.2.3 DFLL Status Bits (PCLKSR Register)

The DFLL status bits in the PCLKSR register during the USB Clock Recovery mode can be incorrect after a USB suspend state.

Workaround

Do not monitor the DFLL status bits in the PCLKSR register during the USB Clock Recovery mode.

Affected Silicon Revisions

F

X

1.3 96 MHz Fractional Digital Phase-Locked Loop (FDPLL)**1.3.1 DPLLATIO Register FDPLL Ratio Value**

When FDPLL ratio value in the DPLLATIO register is changed on the fly, STATUS.DPLLLDRTO will not be set even though the ratio is updated.

Workaround

Monitor the INTFLAG.DPLLLDRTO instead of STATUS.DPLLLDRTO to get the status for DPLLATIO update.

Affected Silicon Revisions

F

X

1.4 ADC**1.4.1 Offset Correction**

Offset correction using the OFFSETCORR register is not supported in the 8-bit and 10-bit conversion resolution.

Workaround

None

Affected Silicon Revisions

F

X

1.5 Device

1.5.1 APB Clock

If the APB clock is stopped and the GCLK is running, APB read access to read-synchronized registers will freeze the system. The CPU and the DAP AHB-AP are stalled, and as a consequence, debug operation is impossible.

Work Around

Do not make read access to read-synchronized registers when the APB clock is stopped and GCLK is running. To recover from this condition, power cycle the device or reset the device using the `RESET` pin.

Affected Silicon Revisions

F

X

1.5.2 SYSTICK Calibration Value

The SYSTICK calibration value specified in the data sheet is incorrect.

Work Around

The correct SYSTICK calibration value is 0x40000000. This value should not be used to initialize the Systick RELOAD value register, which should be initialized instead with a value depending on the main clock frequency and on the tick period required by the application. For a detailed description of the SYSTICK module, refer to the official ARM® Cortex®-M0+ documentation.

Affected Silicon Revisions

F

X

1.5.3 Potential Lockup on Standby Entry

If the Systick interrupt is enabled, a device lockup can occur when the Systick interrupt coincides with the standby entry.

Work Around

Disable the Systick interrupt before entering standby and re-enable it after wake up.

Affected Silicon Revisions

F

X

1.5.4 Potential Lockup on Standby Wakeup with Arm Core PRIMASK=1

Upon wake up from standby with Arm Core register PRIMASK = 1, the first instruction fetched by the CPU in Flash memory will be the first instruction following the WFI. This instruction may be returned corrupted and lead to unpredictable behavior.

If PRIMASK = 0, the first instruction fetched by the CPU will be the first instruction of the interrupt handler. This one will be correctly returned to the CPU.

Work Around

Two possible workarounds can be used independently:

1. Disable Flash sleep in Standby Sleep mode (SLEEPPRM = DISABLED).
2. Place the standby sleep function in SRAM and make sure that at least one dummy Flash fetch is completed before exiting the function. This can be achieved by reading from two different locations in Flash memory with addresses separated by at least the cache size. Because the first read could be a cache hit, the second one will be a cache miss and will force an actual read from Flash memory.

The following code may be used:

```
__attribute__((noinline, section(".ramfunc")))
void ram_sleep(void)
{
    __DSB();
    __WFI();

    // The following sequence ensures that the flash is ready
    before returning from the RAM code
    #define CACHE_SIZE_IN_BYTES 64
    ((volatile unsigned int *)FLASH_ADDR)[CACHE_SIZE_IN_BYTES/
sizeof(unsigned int)]; //will read a word at FLASH_ADDR + 0x40 in this case
    ((volatile unsigned int *)FLASH_ADDR)[(CACHE_SIZE_IN_BYTES*2)/
sizeof(unsigned int)]; //will read a word at FLASH_ADDR + 0x80 in this case
}
```

Affected Silicon Revisions

F
X

1.6 Digital-to-Analog Controller (DAC)

1.6.1 EMPTY Flag is Set When Leaving Standby Mode

When DAC.CTRLA.RUNSTDBY = '0' and DATABUF is written (not empty), and if the device goes to Standby Sleep mode before a Start Conversion event, DAC.INTFLAG.EMPTY will be set after exiting Sleep mode.

Work Around

After waking from Standby mode, ignore and clear the flag DAC.INTFLAG.EMPTY.

Affected Silicon Revisions

F
X

1.7 Direct Memory Access Controller (DMAC)

1.7.1 Consecutive Write Instructions to CRCDATAIN

If data is written to CRCDATAIN in two consecutive instructions, the CRC computation may be incorrect.

Work Around

Add a NOP instruction between each write to the CRCDATAIN register.

Affected Silicon Revisions

F

X

1.7.2 Linked Descriptors

When at least one channel using linked descriptors is already active, enabling another DMA channel (with or without linked descriptors) can result in a channel Fetch Error (FERR) or an incorrect descriptor fetch.

This occurs if the channel number of the channel being enabled is lower than the channel already active.

Work Around

When enabling a DMA channel while other channels using linked descriptors are already active, the channel number of the newly-enabled DMA channel must be greater than the other channel numbers.

Affected Silicon Revisions

F

X

1.8 Device Service Unit (DSU)**1.8.1 Pause-on-Error is Not Functional**

The MBIST Pause-on-Error feature is not functional.

Workaround

None.

Affected Silicon Revisions

F

X

1.9 External Interrupt Controller (EIC)**1.9.1 Interrupts**

When the EIC is configured to generate an interrupt on a low level, rising edge, or both edges (CONFIGn.SENSEx) with the filter enabled (CONFIGn.FILTENx), a spurious flag may appear for the dedicated pin on the INTFLAG.EXTINT[x] register as soon as the EIC is enabled using the CTRLA ENABLE bit.

Work Around

Clear the INTFLAG bit once the EIC is enabled and before enabling the interrupts.

Affected Silicon Revisions

E

X

1.10 Non-Volatile Memory Controller (NVMCTRL)

1.10.1 Spurious Writes

The default value of MANW in NVM.CTRLB is '0', which can lead to spurious writes to the NVM if a data write is done through a pointer with a wrong address corresponding to the NVM area.

Work Around

Set MANW in the NVM.CTRLB register to '1' at start-up

Affected Silicon Revisions

F
X

1.10.2 RWW NVM Command

Incorrect Data Fetch after RWW NVM Command

Issuing an NVM command on RWWEE region while the NVM Controller cache is enabled can result in incorrect data fetch afterward.

Work Around

Disable the NVM Controller cache before issuing any RWW NVM command. Enable the cache only after the internal RWW operation is complete.

Pseudo Code

```
NVMCTRL->CTRLB.CACHEDIS |= NVMCTRL_CTRLB_CACHEDIS_Msk;
NVMRWW_ErasePage();
while(NVMCTRL_IsBusy());
NVMCTRL->CTRLB.CACHEDIS &= ~NVMCTRL_CTRLB_CACHEDIS_Msk;
```

Affected Silicon Revisions

F
X

1.11 PORT - I/O Pin Controller

1.11.1 Write-Protect

The non-debugger IOBUS writes to the PAC Write-protected registers are not prevented when the PORT is PAC Write-protected.

Work Around

None.

Affected Silicon Revisions

F
X

1.12 Serial Communication Interface (SERCOM)

1.12.1 USART in Auto-baud Mode

In USART Auto-Baud mode, missing stop bits are not recognized as inconsistent sync (ISF) or framing (FERR) errors.

Work Around

None.

Affected Silicon Revisions

F

X

1.12.2 NACK and Repeated Start in I²C Host Mode

For High-Speed Host Read operations, sending a NACK (CTRLB.CMD = 0x2) forces a STOP to be issued, making repeated start not possible in this mode.

Work Around

None.

Affected Silicon Revisions

F

X

1.12.3 SERCOM-USART: Collision Detection

In USART Operating mode with Collision Detection enabled (CTRLB.COLDEN = '1'), the SERCOM will not abort the current transfer as expected if a collision is detected and if the SERCOM APB Clock is lower than the SERCOM Generic Clock.

Work Around

The SERCOM APB clock must always be higher than the SERCOM Generic Clock to support collision detection.

Affected Silicon Revisions

F

X

1.12.4 SERCOM-USART: USART in Debug Mode

In USART operating mode, if DBGCTRL.DBGSTOP = '1', data transmission is not halted after entering Debug mode.

Work Around

None.

Affected Silicon Revisions

F

X

1.12.5 SERCOM-I²C: Client Mode with DMA

In I²C Client Transmitter mode, at the reception of a NACK, if there is still data to be sent in the DMA buffer, the DMA will push data to the DATA register. Because a NACK was received, the transfer on the I²C bus will not occur causing the loss of this data.

Work Around

Configure the DMA transfer size to the number of data to be received by the I²C host. DMA cannot be used if the number of data to be received by the host is unknown.

Affected Silicon Revisions

F

X

1.12.6 SERCOM-I²C: I²C Mode in 10-bit Address

10-bit addressing in I²C Client mode is not functional.

Work Around

None.

Affected Silicon Revisions

F

X

1.12.7 SERCOM-SPI: Data Preload

In SPI Client mode and with Client Data Preload Enabled (CTRLB.PLOADEN = '1'), the first data sent from the client will be a dummy byte if the host cannot keep the Client Select (SS) line low until the end of transmission.

Work ArounDs

In SPI Client mode, the Client Select pin (SS) must be kept low by the host until the end of the transmission if the Client Data Preload feature is used (CTRLB.PLOADEN = '1').

Affected Silicon Revisions

F

X

1.12.8 CLKHOLD Bit Status in I²C

STATUS.CLKHOLD bit can be written whereas it is a read-only status bit in both Host and Client modes.

Work ArounDs

Do not clear STATUS.CLKHOLD bit to preserve the current clock hold state.

Affected Silicon Revisions

F

X

1.12.9 Quick Command I²C

When Quick command is enabled (CTRLB.QCEN = '1'), the software can issue a repeated Start by either writing CTRLB.CMD or ADDR.ADDR bit fields. If, in these conditions, SCL Stretch Mode is CTRLA.SCLSM = '1', a bus error will be generated.

Work Arounds

Use Quick Command mode (CTRLB.QCEN = '1') only if SCL Stretch Mode is CTRLA.SCLSM = '0'.

Affected Silicon Revisions

F
X

1.12.10 Repeated Start I²C

For High-Speed Host Write operations, writing CTRLB.CMD = 0x1 issues a STOP command instead of a Repeated Start, making repeated start not possible in that mode.

Work Arounds

None.

Affected Silicon Revisions

F
X

1.12.11 Client Mode I²C

In Client mode, the BUSERR, COLL, LOWTOUT, SEXTTOUT and LENERR STATUS register bits are not automatically cleared when INTFLAG.AMATCH is cleared.

Work Arounds

PERBUFclear the STATUS register bits, such as BUSERR, COLL, LOWTOUT, SEXTTOUT and LENERR by writing these STATUS bits to '1', when INTFLAG.AMATCH is cleared.

Affected Silicon Revisions

F
X

1.12.12 Software Reset in SERCOM module

Software Reset (CTRLA.SWRST=1) is not functional when the SERCOM is not enabled (CTRLA.ENABLE=0).

Work Arounds

None

Affected Silicon Revisions

F
X

1.13 Timer/Counter for Control Applications (TCC)

1.13.1 CAPTMARK is Not Functional

FCTRLX.CAPTURE[CAPTMARK] does not function as described in the data sheet. CAPTMARK cannot be used to identify captured values triggered by fault inputs source A or B on the same channel.

Workaround

Use two different channels to timestamp FaultA and FaultB.

Affected Silicon Revisions

F
X

1.13.2 Advance Capture Mode

Advance capture mode (CAPTMIN CAPTMAX LOCMIN LOCMAX DERIV0) doesn't work if an upper channel is not in one of these mode. For example, when CC[0] = CAPTMIN, CC[1] = CAPTMAX, CC[2] = CAPTEN, and CC[3] = CAPTEN, CAPTMIN and CAPTMAX will not work.

Work Around

Basic capture mode must be set in lower channel and advance capture mode in upper channel.

For example, CC[0] = CAPTEN , CC[1] = CAPTEN , CC[2] = CAPTMIN, CC[3] = CAPTMAX

All capture will be done as expected.

Affected Silicon Revisions

F
X

1.13.3 MAX Capture Mode

In Capture mode while using MAX Capture mode, with the Timer set in up counting mode, if an input event occurs within two cycles before TOP, the value captured is '0' instead of TOP.

Work Arounnds

1. If the event is controllable, the capture event must not occur when the counter is within two cycles before the TOP value.
2. Use the Timer in Down Counter mode and capture the MIN value instead of the MAX value.

Affected Silicon Revisions

F
X

1.13.4 Dithering Mode

Using TCC in Dithering mode with external retrigger events can lead to an unexpected stretch of right-aligned pulses, or a shrink of left-aligned pulses.

Work Around

Do not use retrigger events/actions when the TCC is configured in Dithering mode.

Affected Silicon Revisions

F

X

1.13.5 PATTB

The PATTB register write will not update the PATT register on an update condition.

Work Around

Write directly to the PATT register when an update is required.

Affected Silicon Revisions

F

X

1.13.6 PERBUF

In down-counting mode, the Lock Update bit (CTRLB.LUPD) does not protect against a PER register update from the PERBUF register.

Work Around

None.

Affected Silicon Revisions

F

X

1.13.7 TCC with EVSYS in SYNC/RESYNC Mode

TCC peripheral is not compatible with an EVSYS channel in SYNC or RESYNC mode.

Work Around

Use TCC with an EVSYS channel in ASYNC mode.

Affected Silicon Revisions

F

X

1.13.8 Prescale

A DMA transfer to the TCC.CC register may not initiate when using the TCC MCx as the trigger source (CTRLB.TRIGSRC), and the TCC Prescale (CTRLA.PRESCALE) value is set to 64/256/1024.

Work Around

Use the TCC.CCB for DMA transfers, or the GCLK division register (GENDIV.DIV) to divide the TCC input clock to a range that allows a TCC prescaler value that is not 64, 256 or 1024. To ensure this does not have an impact on other modules in the system, the divided GCLK used to supply the TCC peripheral with its input clock should not source other peripheral modules.

Affected Silicon Revisions

F

X

1.14 Timer/Counter (TC)

1.14.1 TC with EVSYS in SYNC/RESYNC Mode

TC peripheral is not compatible with an EVSYS channel in SYNC or RESYNC mode.

Work Around

Use TC with an EVSYS channel in ASYNC mode.

Affected Silicon Revisions

F

X

1.15 SYSCTRL

1.15.1 XOSC

The XOSC can prevent entry into Standby mode regardless of XOSC.RUNSTDBY value.

Work Around

Change the clock source for gclk0 to the internal RC OSC, and then disable the XOSC before entering Standby mode.

Affected Silicon Revisions

F

X

1.15.2 BOD33 interrupts

The BOD33 interrupt may only generate once if VDDANA does not increase above the user-defined threshold (BOD.LEVEL[5:0]) when in Active mode. If in Standby mode, when the BOD33 interrupt is generated, the device will have to be in Active mode while VDDANA increases above BOD.LEVEL to re-enable the BOD33 interrupt.

Work Around

None.

Affected Silicon Revisions

F

X

1.15.3 BOD33 hysteresis

The BOD33 Hysteresis does not work if either an external reset or a watchdog reset occurs during the time that the Supply voltage is between VBOD- and VBOD+. If one of those resets occurs the device will continue operation if the supply voltage is above VBOD- and the reset condition is lifted.

Work Around

Instead of using the built-in hysteresis it is possible to use the BOD33 Level in the NVM User Row as an upper BOD threshold and configure the SYSCTRL->BOD33 Level bitfield to be the lower treshold and hence generating a hysteresis.

Affected Silicon Revisions

F

X

2. Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest revision of the device Data Sheet (DS20005902B). The corrected information is shown in **BOLD** type.

- None to report at this time

3. Appendix A: Revision History

Rev A Document (6/2022)

The content of this document was included in the product Datasheet (DS20005902A) according to the Atmel format. Subsequent to the conversion of the Datasheet to the Microchip format, this stand-alone document replaced the list of errata present in the product Datasheet (DS20005902A).

The following chapters were added to the list present in the Datasheet (can only be found in this document): [1.1.1](#), [1.2.3](#), [1.4.1](#), [1.5.3](#), [1.5.4](#), [1.6.1](#), [1.10.2](#), [1.11.1](#), [1.12.2](#), [1.12.3](#), [1.12.4](#), [1.12.5](#), [1.12.6](#), [1.12.7](#), [1.12.8](#), [1.12.9](#), [1.12.10](#), [1.12.11](#), [1.12.12](#), [1.13.4](#), [1.13.5](#), [1.13.6](#), [1.13.7](#), [1.13.8](#), [1.15.1](#), [1.15.2](#), [1.15.3](#).

Microchip Information

The Microchip Website

Microchip provides online support via our website at www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable". Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

Legal Notice

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded

by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at www.microchip.com/en-us/support/design-help/client-support-services.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, TrueTime, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, GridTime, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, NVM Express, NVMe, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQL, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, Symmcom, and Trusted Time are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2022, Microchip Technology Incorporated and its subsidiaries. All Rights Reserved.

ISBN: 978-1-6683-0664-2

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
<p>Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Tel: 480-792-7277 Technical Support: www.microchip.com/support Web Address: www.microchip.com</p> <p>Atlanta Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455</p> <p>Austin, TX Tel: 512-257-3370</p> <p>Boston Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088</p> <p>Chicago Itasca, IL Tel: 630-285-0071 Fax: 630-285-0075</p> <p>Dallas Addison, TX Tel: 972-818-7423 Fax: 972-818-2924</p> <p>Detroit Novi, MI Tel: 248-848-4000</p> <p>Houston, TX Tel: 281-894-5983</p> <p>Indianapolis Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380</p> <p>Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800</p> <p>Raleigh, NC Tel: 919-844-7510</p> <p>New York, NY Tel: 631-435-6000</p> <p>San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270</p> <p>Canada - Toronto Tel: 905-695-1980 Fax: 905-695-2078</p>	<p>Australia - Sydney Tel: 61-2-9868-6733</p> <p>China - Beijing Tel: 86-10-8569-7000</p> <p>China - Chengdu Tel: 86-28-8665-5511</p> <p>China - Chongqing Tel: 86-23-8980-9588</p> <p>China - Dongguan Tel: 86-769-8702-9880</p> <p>China - Guangzhou Tel: 86-20-8755-8029</p> <p>China - Hangzhou Tel: 86-571-8792-8115</p> <p>China - Hong Kong SAR Tel: 852-2943-5100</p> <p>China - Nanjing Tel: 86-25-8473-2460</p> <p>China - Qingdao Tel: 86-532-8502-7355</p> <p>China - Shanghai Tel: 86-21-3326-8000</p> <p>China - Shenyang Tel: 86-24-2334-2829</p> <p>China - Shenzhen Tel: 86-755-8864-2200</p> <p>China - Suzhou Tel: 86-186-6233-1526</p> <p>China - Wuhan Tel: 86-27-5980-5300</p> <p>China - Xian Tel: 86-29-8833-7252</p> <p>China - Xiamen Tel: 86-592-2388138</p> <p>China - Zhuhai Tel: 86-756-3210040</p>	<p>India - Bangalore Tel: 91-80-3090-4444</p> <p>India - New Delhi Tel: 91-11-4160-8631</p> <p>India - Pune Tel: 91-20-4121-0141</p> <p>Japan - Osaka Tel: 81-6-6152-7160</p> <p>Japan - Tokyo Tel: 81-3-6880-3770</p> <p>Korea - Daegu Tel: 82-53-744-4301</p> <p>Korea - Seoul Tel: 82-2-554-7200</p> <p>Malaysia - Kuala Lumpur Tel: 60-3-7651-7906</p> <p>Malaysia - Penang Tel: 60-4-227-8870</p> <p>Philippines - Manila Tel: 63-2-634-9065</p> <p>Singapore Tel: 65-6334-8870</p> <p>Taiwan - Hsin Chu Tel: 886-3-577-8366</p> <p>Taiwan - Kaohsiung Tel: 886-7-213-7830</p> <p>Taiwan - Taipei Tel: 886-2-2508-8600</p> <p>Thailand - Bangkok Tel: 66-2-694-1351</p> <p>Vietnam - Ho Chi Minh Tel: 84-28-5448-2100</p>	<p>Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393</p> <p>Denmark - Copenhagen Tel: 45-4485-5910 Fax: 45-4485-2829</p> <p>Finland - Espoo Tel: 358-9-4520-820</p> <p>France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79</p> <p>Germany - Garching Tel: 49-8931-9700</p> <p>Germany - Haan Tel: 49-2129-3766400</p> <p>Germany - Heilbronn Tel: 49-7131-72400</p> <p>Germany - Karlsruhe Tel: 49-721-625370</p> <p>Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44</p> <p>Germany - Rosenheim Tel: 49-8031-354-560</p> <p>Israel - Ra'anana Tel: 972-9-744-7705</p> <p>Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781</p> <p>Italy - Padova Tel: 39-049-7625286</p> <p>Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340</p> <p>Norway - Trondheim Tel: 47-72884388</p> <p>Poland - Warsaw Tel: 48-22-3325737</p> <p>Romania - Bucharest Tel: 40-21-407-87-50</p> <p>Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91</p> <p>Sweden - Gothenberg Tel: 46-31-704-60-40</p> <p>Sweden - Stockholm Tel: 46-8-5090-4654</p> <p>UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820</p>