

AVR128DA Silicon Errata and Data Sheet Clarification

AVR128DA28/32/48/64(S)



The AVR128DA28/32/48/64(S) devices you have received conform functionally to the current device data sheet (www.microchip.com/DS40002183), except for the anomalies described in this document. The errata described in this document will likely be addressed in future revisions of the AVR128DA28/32/48/64(S) devices.

Notes:

- This document summarizes all the silicon errata issues from all the silicon revisions, previous and current
- Refer to the Device/Revision ID section in the current device data sheet (www.microchip.com/DS40002183) for more detailed information on Device Identification and Revision IDs for your specific device, or contact your local Microchip sales office for assistance

1. Silicon Issue Summary

Legend

- Erratum is not applicable.
- X Erratum is applicable.

Peripheral	Short Description	Valid for Silicon Revision			
		Rev. A6 ⁽¹⁾	Rev. A7	Rev. A8	Rev. AB
Device	Some Reserved Fuse Bits Are '1'	X	X	X	X
	Endurance of Flash Memory Cell is Lower than Specified	X	X	X	X
	CRC Check During Reset Initialization Is not Functional	X	X	X	-
	Write Operation Lost if Consecutive Writes to Specific Address Spaces	X	X	X	X
CCL	The LINK Input Source Selection for LUT3 Is not Functional on 28- and 32-Pin Devices	X	X	X	X
CLKCTRL	PLL Status not Working as Expected	X	X	X	X
DAC	DAC Output Buffer Lifetime Drift	X	X	X	X
EVSYS	Port Pins PB[7:6] and PE[7:4] Are not Connected to the Event System	X	X	X	X
NVMCTRL	Flash Mapping Into Data Space not Working Properly	X	X	X	X
	Flash Multi-Page Erase Can Erase Write Protected Section	X	X	X	X
	NVM_EEPROM_ERASE Command does Not Respect Write Protect	X	X	X	X
PORT	Digital Input on Pin Automatically Disabled When Pin Selected for Analog Input	X	X	X	X
RSTCTRL	BOD Registers not Reset When UPDI Is Enabled	X	X	X	X
SPI	SSD Bit Must Be Set When SPIROUTE Value = NONE	X	X	X	X
TCA	TCA1 Pinout Alternative 2 and 3 not Functional	X	X	X	X
	Restart Will Reset Counter Direction in NORMAL and FRQ Mode	X	X	X	X
TCB	CCMP and CNT Registers Act as 16-Bit Registers in 8-Bit PWM Mode	X	X	X	X
TCD	Asynchronous Input Events not Working When TCD Counter Prescaler Is Used	X	X	X	X
	CMPAEN Controls All WOx for Alternative Pin Functions	X	X	X	X
	Halting TCD and Waiting for SW Restart Does Not Work if Compare Value A is 0 or Dual Slope Mode is Used	X	X	X	X
TWI	The Output Pin Override Does not Function as Expected	X	X	X	X
	The 50 ns and 300 ns SDA Hold Time Selection Bits Are Swapped	X	X	X	X
	Flush Non-Functional	X	X	X	X
USART	Open-Drain Mode Does not Work When TXD Is Configured as Output	X	X	X	X
	Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode	X	X	X	X
	Receiver Non-Functional after Detection of Inconsistent Synchronization Field	X	X	X	X
ZCD	All ZCD Output Selection Bits Are Tied to the ZCD0 Bit	X	X	X	X

Note:

1. This revision is the initial release of the silicon.

2. Silicon Errata Issues

2.1 Errata Details

- Erratum is not applicable.
- X Erratum is applicable.

2.2 Device

2.2.1 Some Reserved Fuse Bits Are '1'

For material with date code 2033 (manufactured in the year 2020, week 33) or older, the default fuse values are not compliant with the data sheet. The fuse values will read out as listed below:

- BODCFG = 0x10
- OSCCFG = 0x78 (The device will use the OSCHF clock source)
- SYSCFG0 = 0xF2
- SYSCFG1 = 0xF8

Work Around

None.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.2.2 Endurance of Flash Memory Cell is Lower than Specified

The Flash memory cell endurance specification (parameter E_p) is lower than specified in the device data sheet. The Flash memory cell endurance is 1K cycles instead of 10K cycles.

Work Around

None.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.2.3 CRC Check During Reset Initialization Is not Functional

For material with date code 2136 (manufactured in the year 2021, week 36) or older, the CRCSRC bit field in the SYSCFG0 fuse is ignored during Reset initialization. A CRC check will not be performed during Reset initialization. CRCSCAN is only available from the software.

Work Around

None.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	-

2.2.4 Write Operation Lost if Consecutive Writes to Specific Address Spaces

An ST/STD/STS instruction to address ≥ 64 followed by either an ST/STD instruction to address < 64 or a write to the SLPCTRL.CTRLA register will cause a loss of the last write.

Work Around

To avoid loss of write operation, use one of the following workarounds depending on address space:

- Insert an NOP instruction before writing to address < 64, or use the OUT instruction instead of ST/STD
- Insert an NOP instruction before writing to SLPCTRL.CTRLA register

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.3 CCL - Configurable Custom Logic**2.3.1 The LINK Input Source Selection for LUT3 Is not Functional on 28- and 32-Pin Devices**

The LINK option (INSELn in LUT3CTRLB or LUT3CTRLC is '0x2') does not work; the output from LUT0 will not get connected as an input to LUT3. This occurs only on 28-pin and 32-pin devices.

Work Around

Connect LUT0 output to LUT3 input using the Event System.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.4 CLKCTRL - Clock Controller**2.4.1 PLL Status not Working as Expected**

The PLL Status (PLLS) bit in the Main Clock Status (MCLKSTATUS) register will never be set to '1' if the Run Standby (RUNSTDBY) bit in PLL Control A (PLLCTRLA) register is set to '1' and no peripherals are requesting the PLL oscillator.

Work Around

None.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.5 DAC - Digital-to-Analog Converter**2.5.1 DAC Output Buffer Lifetime Drift**

The offset of the DAC output buffer can drift over the device's lifetime if powered with the DAC output buffer disabled.

Work Around

Keep the DAC output buffer enabled (OUTEN in DACn.CTRLA is '1') continuously or compensate by measuring the DAC output voltage offset with the ADC and adjust the DAC data register value (DATA[9:0] in DACn.DATA) accordingly.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.6 EVSYS - Event System

2.6.1 Port Pins PB[7:6] and PE[7:4] Are not Connected to the Event System

Port pins PB[7:6] and PE[7:4] are not connected to the Event System. This is true for both input and output signals into the Event System on these pins.

Work Around

None.


Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.7 NVMCTRL - Nonvolatile Memory Controller

2.7.1 Flash Mapping Into Data Space not Working Properly

The inter-section Flash protection mechanism does not take into account the FLMAP bit field when checking if the address is in BOOT, APPCODE or APPDATA areas. It uses for comparison only the address offset between Flash start address in data space (0x8000) and the accessed address. This will cause the mirroring of the BOOT area in each Flash section selected by FLMAP (in blocks of 32 KB). Refer to the image below.

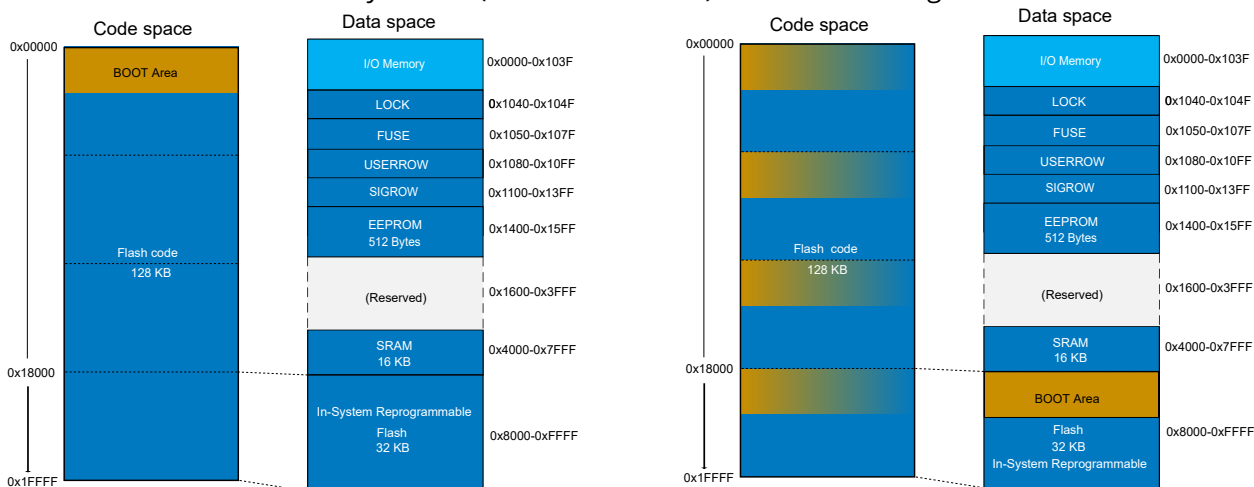

For read operations, the FLMAP bits work as documented when the Boot Read Protect (BOOTRP) bit is not enabled. For write operations, the inter-section Flash protection works properly only when FLMAP is set to '0x00'.

Work Around

Use only store program memory (SPM) instructions to write and load program memory (LPM) instructions to read Flash memory.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.7.2 Flash Multi-Page Erase Can Erase Write Protected Section

When using Flash Multi-Page Erase mode, only the first page in the selected address range is verified to be within a section that is not write-protected. If the address range includes any write-protected Application Data pages, it will erase them.

Work Around

None.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.7.3 NVM_EEPROM_ERASE Command does Not Respect Write Protect

The NVM_EEPROM_ERASE command does not respect the EEPROM Write Protected (EERP) bit in the Control B (NVMCTRL.CTRLB) register. Content will be erased even though it should not.

Work Around

None.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.8 PORT - I/O Configuration

2.8.1 Digital Input on Pin Automatically Disabled When Pin Selected for Analog Input

If an input pin is selected to be analog input, the digital input function for those pins is automatically disabled.

Work Around

None

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.9 RSTCTRL - Reset Controller

2.9.1 BOD Registers not Reset When UPDI Is Enabled

If the UPDI is enabled, the VLMCTRL, INTCTRL, and INTFLAGS registers in BOD will not be reset by other reset sources than POR.

Work Around

None

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.10 SPI - Serial Peripheral Interface

2.10.1 SSD Bit Must Be Set When SPIROUTE Value = NONE

When operating either SPIn module, when the PORTMUX.SPIROUTE selection is NONE, the \overline{SS} pin must be disabled (CTRLB.SSD = 1) to maintain Host mode operation.

Work Around

None

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.11 TCA - 16-Bit Timer/Counter Type A

2.11.1 TCA1 Pinout Alternative 2 and 3 not Functional

It is not possible to configure TCA1 in PORTMUX.TCAROUTEA to use pinout alternatives 2 and 3.

Work Around

Use TCA1 pinout alternative 0 or 1.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.11.2 Restart Will Reset Counter Direction in NORMAL and FRQ Mode

When the TCA is configured to a NORMAL or FRQ mode (WGMODE in TCAn.CTRLB is '0x0' or '0x1'), a RESTART command or Restart event will reset the count direction to default. The default is counting upwards.

Work Around

None.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.12 TCB - 16-Bit Timer/Counter Type B

2.12.1 CCMP and CNT Registers Act as 16-Bit Registers in 8-Bit PWM Mode

When the TCB is operating in 8-bit PWM mode (CNTMODE in TCBn.CTRLB is '0x7'), the low and high bytes for the CCMP and CNT registers act as 16-bit registers for read and write. They cannot be read or written independently.

Work Around

Use 16-bit register access. Refer to the data sheet for further information.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.13 TCD - 12-Bit Timer/Counter Type D

2.13.1 Asynchronous Input Events not Working When TCD Counter Prescaler Is Used

When configuring TCD to use asynchronous input events (CFG in TCDn.EVCTRLx is '0x2') and the TCD Counter Prescaler (CNTPRES in TCDn.CTRLA) is different from '0x0', events can be missed.

Work Around

Use the TCD Synchronization Prescaler (SYNCPRES in TCDn.CTRLA) instead of the TCD Counter Prescaler. Alternatively, use synchronous input events (CFG in TCDn.EVCTRLx is not '0x2') if the input events are longer than one CLK_TCD_CNT cycle.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.13.2 CMPAEN Controls All W0x for Alternative Pin Functions

When TCD alternative pins are enabled (TCD0 in PORTMUX.TCDROUTEA is not '0x0'), all waveform outputs (W0x) are controlled by Compare A Enable (CMPAEN in TCDn.FAULTCTRL).

Work Around

None.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.13.3 Halting TCD and Waiting for SW Restart Does Not Work if Compare Value A is 0 or Dual Slope Mode is Used

Halting TCD and waiting for software restart (INPUTMODE in TCDn.INPUTCTRLA is '0x7') does not work if compare value A is 0 (CMPASET in TCDn.CMPASET is '0x0') or Dual Slope mode is used (WGMODE in TCDn.CTRLB is '0x3').

Work Around

Configure the compare value A (CMPASET in TCDn.CMPASET) to be different from 0 and do not use Dual Slope mode (WGMODE in TCDn.CTRLB is not '0x3').

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.14 TWI - Two-Wire Interface

2.14.1 The Output Pin Override Does not Function as Expected

It overrides the output pin driver but not the output value when TWI is enabled. The output on the line will always be high when the value in the PORTx.OUT register is '1' for the pins corresponding to the SDA or SCL.

Work Around

Ensure that the values in the PORTx.OUT register corresponding to the SCL and SDA pins are '0' before enabling the TWI.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.14.2 The 50 ns and 300 ns SDA Hold Time Selection Bits Are Swapped

The bits corresponding to the SDA Hold Time (SDAHOLD) bit field in the TWIn.CTRLA register are swapped.

Work Around

Use the 50 ns bit field selection for the 300 ns hold time and vice versa.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.14.3 Flush Non-Functional

Issuing a Flush by writing to the FLUSH bit in TWIn.MCTRLB can cause the TWI Host to be stuck in the Unknown bus state (see BUSSTATE in TWIn.MSTATUS).

Work Around

Disable and re-enable the Host using the ENABLE bit in TWIn.MCTRLA. An ordinary operation does not require the use of FLUSH.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.15 USART - Universal Synchronous and Asynchronous Receiver and Transmitter**2.15.1 Open-Drain Mode Does not Work When TXD Is Configured as Output**

When configured as an output, the USART TXD pin can drive the pin high regardless of whether the Open-Drain mode is enabled or not.

Work Around

Configure the TXD pin as an input by writing the corresponding bit in PORTx.DIR to '0' when using Open-Drain mode.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.15.2 Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode

The Start-of-Frame Detection feature enables the USART to wake up from Standby sleep mode upon data reception. The Start-of-Frame Detector can unintentionally be triggered when the Start-of-Frame Detection Enable (SFDEN) bit in the USART Control B (USARTn.CTRLB) register is set, and the device is in Active mode. If the Receive Data (RXDATA) registers are read while receiving new data, the Receive Complete Interrupt Flag (RXCIF) in the USARTn.STATUS register is cleared. This triggers the Start-of-Frame Detector and falsely detects the next falling edge as a start bit. When the Start-of-Frame Detector detects a start condition, the frame reception is restarted, resulting in corrupt received data. Note that the USART Receive Start Interrupt Flag (RXSIF) always is '0' when in Active mode. No interrupt will be triggered.

Work Around

Disable Start-of-Frame Detection by writing '0' to the Start-of-Frame Detection Enable (SFDEN) bit in the USART Control B (USARTn.CTRLB) register when the device is in Active mode. Re-enable it by writing the bit to '1' before transitioning to Standby sleep mode. This work around depends on a protocol preventing a new incoming frame when re-enabling Start-of-Frame Detection. Re-enabling Start-of-Frame Detection, while a new frame is already incoming, will result in corrupted received data.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.15.3 Receiver Non-Functional after Detection of Inconsistent Synchronization Field

The USART Receiver becomes non-functional when the Inconsistent Synchronization Field Interrupt Flag (ISFIF) in the Status (USARTn.STATUS) register is set. The ISFIF interrupt flag is set when the Receiver Mode (RXMODE) bit field in the Control B (USARTn.CTRLB) register is configured to Generic Auto-Baud (GENAUTO) or LIN Constrained Auto-Baud (LINAUTO) mode, and the received synchronization frame does not conform to the conditions described in the data sheet. Clearing the flag does not re-enable the USART Receiver.

Work Around

When the ISFIF interrupt flag is set, disable and re-enable the USART Receiver by first writing a '0' and then a '1' to the Receiver Enable (RXEN) bit in the Control B (USARTn.CTRLB) register.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

2.16 ZCD - Zero-Cross Detector**2.16.1 All ZCD Output Selection Bits Are Tied to the ZCD0 Bit**

The Zero Cross Detector n Output (ZCDn) bits in the Pin Position (PORTMUX.ZCDROUTEA) register are tied to ZCD0. Any write to ZCD0 will be reflected in the ZCD1 and ZCD2 as well. Writing to ZCD1 and/or ZCD2 has no effect.

Work Around

Use the Event System or CCL to make the output of ZCD1 or ZCD2 available on a pin.

Affected Silicon Revisions

Rev. A6	Rev. A7	Rev. A8	Rev. AB
X	X	X	X

3. Data Sheet Clarifications

Note the following typographic corrections and clarifications for the latest version of the device data sheet (www.microchip.com/DS40002183).

Note: Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

4. Document Revision History

Note: The document revision is independent of the silicon revision.

4.1 Revision History

Doc. Rev.	Date	Comments
F	09/2024	<ul style="list-style-type: none"> • Added new device revision (AB) • Added errata: <ul style="list-style-type: none"> - Device: <i>Write Operation Lost if Consecutive Writes to Specific Address Spaces</i>
E	12/2023	<ul style="list-style-type: none"> • Removed data sheet clarifications: <ul style="list-style-type: none"> - 3.1. Features - 3.2. FUSE - Configuration and User Fuses - 3.3. RSTCTRL - Reset Controller - 3.4. TWI - Two-Wire Interface - 3.5. Electrical Characteristics - Peripheral Power Consumption - 3.6. Electrical Characteristics - Memory Programming Specifications - 3.7. Electrical Characteristics - VREF - 3.8. Electrical Characteristics - DAC - 3.9. Electrical Characteristics - ADC
D	02/2022	<ul style="list-style-type: none"> • Added data sheet clarifications: <ul style="list-style-type: none"> - 3.1. Features - 3.2. FUSE - Configuration and User Fuses - 3.5. Electrical Characteristics - Peripheral Power Consumption - 3.6. Electrical Characteristics - Memory Programming - 3.7. Electrical Characteristics - VREF - 3.8. Electrical Characteristics - DAC - 3.9. Electrical Characteristics - ADC • Updated data sheet clarifications: <ul style="list-style-type: none"> - 3.3. RSTCTRL - Reset Controller - 3.4. TWI - Two-Wire Interface
C	10/2021	<ul style="list-style-type: none"> • Updated errata: <ul style="list-style-type: none"> - Device: <i>Some Reserved Fuse Bits Are '1'</i> - Device: <i>CRC Check During Reset Initialization Is Not Functional</i> - USART: <i>Start-of-Frame Detection Can Unintentionally Be Enabled in Active Mode When RXCIF Is '0'</i> • Added errata: <ul style="list-style-type: none"> - CLKCTRL: <i>PLL Status Not Working as Expected</i> - DAC: <i>DAC Output Buffer Lifetime Drift</i> - TCD: <i>Halting TCD and Wait for SW Restart Does Not Work if Compare Value A Is 0 or Dual Slope Mode Is Used</i> - TWI: <i>Flush Nonfunctional</i> - Electrical Characteristics: <i>Endurance of PFM Cell lower is than specified</i>

.....continued

Doc. Rev.	Date	Comments
B	11/2020	<ul style="list-style-type: none"> • Added new device revision (A8) • Added errata: <ul style="list-style-type: none"> - Device: <i>Some Reserved Fuse Bits Are '1'</i> - Device: <i>CRC Check During Reset Initialization Is Not Functional</i> - CCL: <i>The LINK Input Source Selection for LUT3 Is Not Functional on 28- and 32-Pin Device</i> - RSTCTRL: <i>BOD Registers Not Reset When UPDI Is Enabled</i> - TCA: <i>Restart Will Reset Counter Direction in NORMAL and FRQ Mode</i> - TCB: <i>CCMP and CNT Registers Operate as 16-Bit Registers in 8-Bit PWM Mode</i> - TCD: <i>Asynchronous Input Events Not Working When TCD Counter Prescaler Is Used</i> - TCD: <i>CMPAEN Controls All WOx for Alternative Pin Functions</i> - USART: <i>Start-of-Frame Detection Can Unintentionally Be Enabled in Active Mode When RXCIF Is '0'</i> - ZCD: <i>All ZCD Output Selection Bits Are Tied to the ZCD0 Bit</i>
A	04/2020	Initial document release

Microchip Information

The Microchip Website

Microchip provides online support via our website at www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user’s guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip’s product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is “unbreakable”. Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

Legal Notice

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure

that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at www.microchip.com/en-us/support/design-help/client-support-services.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, TimeCesium, TimeHub, TimePictra, TimeProvider, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, Clockstudio, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, EyeOpen, GridTime, IdealBridge, IGaT, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, IntelliMOS, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, MarginLink, maxCrypto, maxView, memBrain, Minda, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, mSiC, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, Power MOS IV, Power MOS 7, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, Trusted Time, TSHARC, Turing, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2024, Microchip Technology Incorporated and its subsidiaries. All Rights Reserved.

ISBN: 978-1-6683-0208-8

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: www.microchip.com/support Web Address: www.microchip.com	Australia - Sydney Tel: 61-2-9868-6733 China - Beijing Tel: 86-10-8569-7000 China - Chengdu Tel: 86-28-8665-5511 China - Chongqing Tel: 86-23-8980-9588 China - Dongguan Tel: 86-769-8702-9880 China - Guangzhou Tel: 86-20-8755-8029 China - Hangzhou Tel: 86-571-8792-8115 China - Hong Kong SAR Tel: 852-2943-5100 China - Nanjing Tel: 86-25-8473-2460 China - Qingdao Tel: 86-532-8502-7355 China - Shanghai Tel: 86-21-3326-8000 China - Shenyang Tel: 86-24-2334-2829 China - Shenzhen Tel: 86-755-8864-2200 China - Suzhou Tel: 86-186-6233-1526 China - Wuhan Tel: 86-27-5980-5300 China - Xian Tel: 86-29-8833-7252 China - Xiamen Tel: 86-592-2388138 China - Zhuhai Tel: 86-756-3210040	India - Bangalore Tel: 91-80-3090-4444 India - New Delhi Tel: 91-11-4160-8631 India - Pune Tel: 91-20-4121-0141 Japan - Osaka Tel: 81-6-6152-7160 Japan - Tokyo Tel: 81-3-6880-3770 Korea - Daegu Tel: 82-53-744-4301 Korea - Seoul Tel: 82-2-554-7200 Malaysia - Kuala Lumpur Tel: 60-3-7651-7906 Malaysia - Penang Tel: 60-4-227-8870 Philippines - Manila Tel: 63-2-634-9065 Singapore Tel: 65-6334-8870 Taiwan - Hsin Chu Tel: 886-3-577-8366 Taiwan - Kaohsiung Tel: 886-7-213-7830 Taiwan - Taipei Tel: 886-2-2508-8600 Thailand - Bangkok Tel: 66-2-694-1351 Vietnam - Ho Chi Minh Tel: 84-28-5448-2100	Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393 Denmark - Copenhagen Tel: 45-4485-5910 Fax: 45-4485-2829 Finland - Espoo Tel: 358-9-4520-820 France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79 Germany - Garching Tel: 49-8931-9700 Germany - Haan Tel: 49-2129-3766400 Germany - Heilbronn Tel: 49-7131-72400 Germany - Karlsruhe Tel: 49-721-625370 Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44 Germany - Rosenheim Tel: 49-8031-354-560 Israel - Hod Hasharon Tel: 972-9-775-5100 Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781 Italy - Padova Tel: 39-049-7625286 Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340 Norway - Trondheim Tel: 47-72884388 Poland - Warsaw Tel: 48-22-3325737 Romania - Bucharest Tel: 40-21-407-87-50 Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 Sweden - Gothenberg Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820