

KSZ9563R Silicon Errata and Data Sheet Clarification

This document describes known silicon errata for the Microchip KSZ9563R. The silicon errata discussed in this document are for silicon revisions as listed in [Table 1](#). The silicon revision can be determined by the device's top marking. A summary of KSZ9563R silicon errata is provided in [Table 2](#).

TABLE 1: AFFECTED SILICON REVISIONS

Part Number	Silicon Revision
KSZ9563RNX	B2

TABLE 2: SILICON ISSUE SUMMARY

Item Number	Silicon Issue Summary	Affected Silicon Revisions
1.	When tail tag is enabled, frame length field check fails for 802.3 frames	B2
2.	Port based priority remapping is not supported	B2
3.	1000BASE-T PMA-EEE fails to meet the IEEE Refresh Time specification	B2
4.	1000BASE-T Master Mode may not link up successfully on the first attempt	B2
5.	1000BASE-T Transmit Output Voltage may fail to meet IEEE compliance specification	B2
6.	1000BASE-T Transmitter Distortion fails to meet IEEE compliance specification	B2
7.	Transmission halt with late collisions	B2
8.	LEDx_0 in Single-LED Mode does not indicate link activity	B2
9.	GPIO_2 does not function properly	B2

Silicon Errata Issues

Module 1: When tail tag is enabled, frame length field check fails for 802.3 frames

DESCRIPTION

The comparison of the length field of the Ethernet frame with the actual length of the data field portion of the frame fails for the ingress packets with tail tag. This issue is not applicable to packets with the type field in the frame.

END USER IMPLICATIONS

The packets will be dropped when length check fails for the packet.

Work Around

Disable the length check in bit 3 of the register 0x0330 (Global Switch MAC Control Register 0). The Microchip provided driver disables the length check.

PLAN

This erratum will not be corrected in a future revision.

KSZ9563R

Module 2: Port based priority remapping is not supported

DESCRIPTION

The 802.1Q-2014 Clause 6 (6.9.4 Regenerating priority) describes the Priority Regeneration Table for the reception port, which is required to support an AVB boundary port. The boundary port in the AVB domain needs to remap the priority field of the incoming traffic.

Since the device do not support port based priority remapping, the port cannot be used as a boundary port.

This erratum is not applicable if all the device ports are AVB domain ports.

END USER IMPLICATIONS

The device port cannot be used as an AVB domain boundary port to networks that utilize the scheduler.

Work Around

A software workaround is available to remap the priority of all the incoming traffic to the port. The workaround uses an ACL (Access Control List) mechanism to remap the priority of the incoming traffic to 0. With the workaround, there is no impact on AVB traffic. If the incoming traffic uses QoS, priorities are also remapped to 0. This may have a minor impact on the QoS traffic (i.e., all the QoS traffic uses one egress queue instead of using the two queues available in the device). The workaround is available in Microchip provided driver software.

Software Workaround:

Program the ACL rule to remap all the incoming layer 2 packets to priority 0 (ACL rule format shown in [Figure 1](#)).

FIGURE 1: ACL RULE FORMAT



Rule Description:

- MD = 01 : Layer 2
- ENB = 10 : Comparison on EtherType value
- EQ = 0 & TYPE = 0 : I.e., all packets (condition is when EtherType != 0)
- PM = 11 : Always change priority to P[2:0]
- P = 0 : Priority value to be changed

PLAN

This erratum will not be corrected in a future revision.

Module 3: 1000BASE-T PMA-EEE fails to meet the IEEE Refresh Time specification

DESCRIPTION

The device's 1000BASE-T Transmit Refresh Time for Waketx time (Full) is approximately 1.47-1.48 μ s, versus the <1.40 μ s indicated in the IEEE specification.

END USER IMPLICATIONS

With the default setting, the Refresh Time is slightly outside the specification, and the transmitter is not fully compliant with the IEEE standard. This may degrade performance with some 1000BASE-T EEE PHY link partners.

Work Around

Write to the following MMD register for each PHY port [1-2] to set the Refresh Time to 0.85 μ s:

[MMD]	[register]	[data]
0x3	0xE	0x0021

PLAN

This erratum will not be corrected in a future revision.

Module 4: 1000BASE-T Master Mode may not link up successfully on the first attempt

DESCRIPTION

The device's first 1000BASE-T link-up attempt when in Master Mode may drop link immediately before always linking successfully and maintaining link on the second attempt. This behavior occurs mainly at long cable lengths (~100 meters).

END USER IMPLICATIONS

When the device operates in 1000BASE-T Master Mode, the system application needs to account for a possible second link-up attempt, especially with long cable.

Work Around

None.

PLAN

This erratum will not be corrected in a future revision.

Module 5: 1000BASE-T Transmit Output Voltage may fail to meet IEEE compliance specification

DESCRIPTION

The device's 1000BASE-T Transmit Output Voltage Template may fail to meet the following IEEE specifications when operating at low voltage (-5% of nominal for AVDDH and core supply voltages) and high temperature (+85°C).

1. Percent difference between Points A, B may slightly exceed the <1.0% per the IEEE specification.
2. Peak Voltage for Points A, B, C, D, F, H may slightly touch the voltage template defined per the IEEE specification.

END USER IMPLICATIONS

It is unlikely the marginal specification failures will impact system performance. Extensive testing has been performed to ensure the device can inter-operate with different Gigabit PHY link partners.

Work Around

None.

PLAN

This erratum will not be corrected in a future revision.

Module 6: 1000BASE-T Transmitter Distortion fails to meet IEEE compliance specification

DESCRIPTION

The device's 1000BASE-T Transmitter Distortion is approximately 40mV, versus the <10mV indicated in the IEEE specification.

END USER IMPLICATIONS

It is unlikely this specification failure will impact system performance. The following link to the Gigabit Transmit Distortion Testing document on the IEEE802.org website also questions the validity of this measurement:


http://www.ieee802.org/3/axay/public/may_07/sefidvash_1_0507.pdf

IEEE testing calls for <10mV peak transmitter distortion for at least 60% of the UI within the eye opening. However, this measurement might not be valid, as the transmit distortion test is sensitive to transmit jitter. Refer to the explanation below, taken from the aforementioned IEEE document.

The Gigabit Transmit Distortion Testing document indicates:

- On page 6, a contradiction between Transmit Jitter and Transmit Distortion requirements:

FIGURE 2: IEEE DOCUMENT PAGE 6

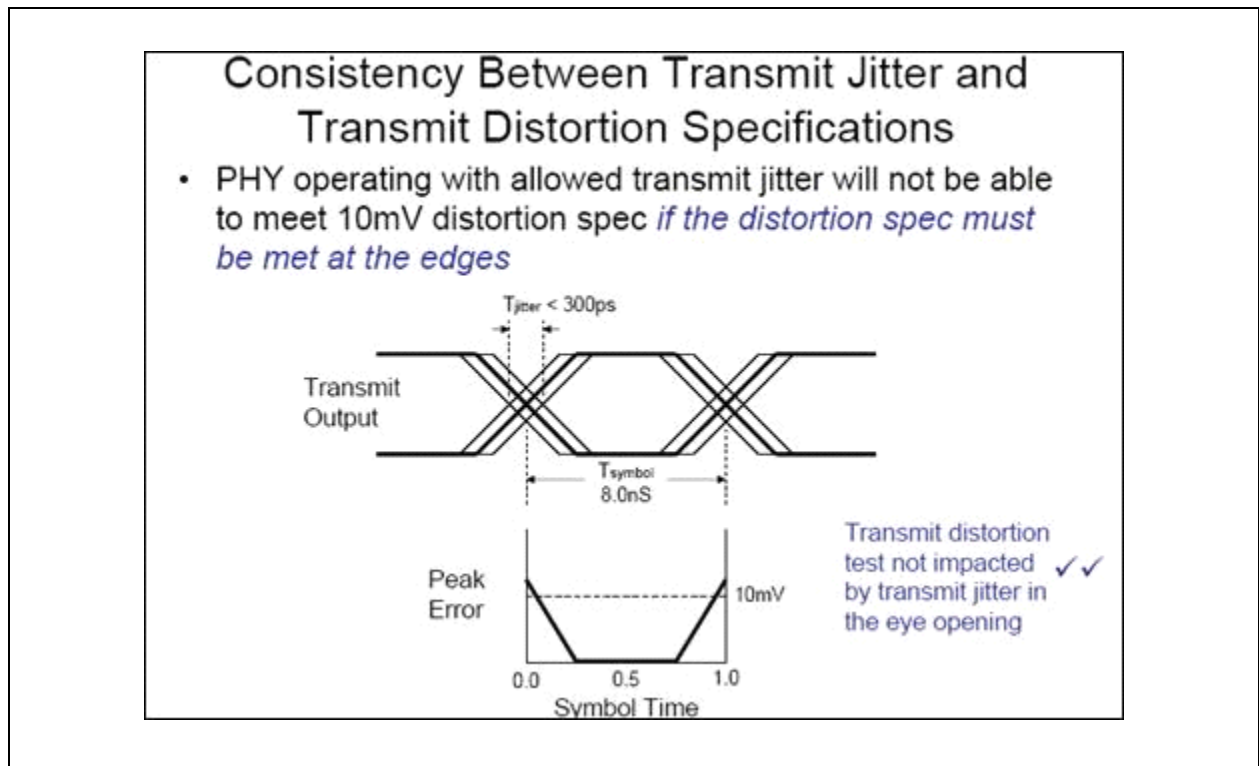

- On page 7:
 - The transmit distortion test is sensitive to transmit clock jitter during the rise/fall time.
 - It is recommended to change the requirement to use at least 30%, instead of at least 60%, of the UI within the eye opening for the <10mV peak transmitter distortion.

FIGURE 3: IEEE DOCUMENT PAGE 7

Defining the “Settled” Interval for Transmit Distortion Testing

- Currently defined transmit distortion test is sensitive to transmit clock jitter during the rise/fall time of the transmitter
 - Error voltage will be contaminated by jitter during transitions
 - Portion of error contributed by distortion cannot be determined during transitions
 - Appropriate place to apply test is after the rise/fall time where the waveform has settled to it's final value
- Clause 40.6.1.2.3 specifies a 5ns rise/fall time (note #3)
 - 3ns of 8ns (37.5%) of UI will be free from effects of jitter
 - Recommend to use 30% for ease of testing
 - ie: measure error voltage at 10 phases, require 3 of these measurements to be below 10mV

Extensive testing has been performed to ensure the device can inter-operate with different Gigabit PHY link partners.

Work Around

None.

PLAN

This erratum will not be corrected in a future revision.

Module 7: Transmission halt with late collisions

DESCRIPTION

Section 4 of the IEEE 802.3 Specification details Carrier Sense Multiple Access / Collision Detection (CSMA/CD) parameters when operating in half-duplex mode. The first 512 bit times are designated as the slotTime, which is the maximum amount of time allowed for a collision to occur. If a link partner is configured incorrectly, where the PHY is linking in half-duplex mode but the MAC is configured in full-duplex mode, there is a chance that the link partner will generate a collision after the first 512 bit times, violating the IEEE 802.3 specification. These late collisions, combined with other factors, can cause the switch port transmitter to lock up and stop sending packets. The receiver will still function.

END USER IMPLICATIONS

If this erratum occurs, the switch will stop transmitting data to the half-duplex port, making it seem the half-duplex link partner has stopped communicating to the network. The more traffic there is, the greater the risk of the violating link partner generating a late collision that will affect the port.

Work Around

Ideally, the link partner that is violating the specification would need to be updated so the MAC and PHY are correctly configured to the same duplex setting. If the link partner cannot be modified to conform to the IEEE 802.3 specification, the switch can be re-configured to full-duplex when late collisions are detected to avoid a lock up condition. Of note, each switch port functions independently. Therefore, any work around must be implemented separately for each port.

Method 1:

To avoid transmitter lock up, when a port is linked in half-duplex mode, the software should monitor the TxLateCollision MIB counter (MIB Index 0x16). If the number is ever non-zero, the software should force the link to function in full-duplex mode by disabling auto-negotiation and setting full-duplex and the appropriate speed in the PHY Basic Control Registers (addresses 0xN100 - 0xN101).

Method 2:

To detect transmitter lock up, the software should monitor the TxByteCnt (MIB Index 0x81) and the RxByteCnt (MIB Index 0x80). If the RxByteCnt is incrementing but the TxByteCnt remains the same, the software should perform a hard reset of the switch.

PLAN

This erratum will not be corrected in a future revision.

Module 8: LEDx_0 in Single-LED Mode does not indicate link activity

DESCRIPTION

The PHY Port (1-2) LEDx_0 does not go low in the presence of link activity when in Single-LED Mode.

END USER IMPLICATIONS

Link activity cannot be determined in Single-LED Mode. However, LEDx_1 will indicate if the link is up or down. The lack of status leads to uncertainty that traffic is passing through the port.

Work Around

No work around exists for Single-LED Mode. Both PHY port LEDs work properly in Tri-Color Dual-LED Mode, which is the default LED mode.

PLAN

This erratum will not be corrected in a future revision.

Module 9: GPIO_2 does not function properly

DESCRIPTION

Pins GPIO_1 and GPIO_2 are intended to output programmed signals that are timed to the internal clock. They may also be used for timestamping of input signals. GPIO_1 functions as intended, but GPIO_2 does not. GPIO_2 outputs a 25MHz clock when link is up on either of the two PHY ports, preventing its use as a GPIO. If a second GPIO output pin is needed, the LED2_1 pin can be re-assigned for this purpose.

END USER IMPLICATIONS

GPIO_2 cannot be used for input timestamping or for outputting programmed signals. The 25MHz clock output on GPIO_2 cannot be disabled, so it is best to leave the pin unconnected on board designs. LED2_1 can be assigned to take the place of GPIO_2 for output functionality, but this displaces the LED functionality of LED2_1.

There is no alternative for input timestamping on GPIO_2. Input timestamping is available only on GPIO_1, not on any other pins.

Work Around

The output functionality of GPIO_2 can be routed to LED2_1 by setting bit 3 in the LED2_0/LED2_1 Source Register at address 0x0128 - 0x012B.

No other changes are required. When setting up the trigger output units, any output programmed to go to GPIO_2 will output on LED2_1 if the above bit is set. Any of the three trigger units can be used.

PLAN

This erratum will not be corrected in a future revision.

APPENDIX A: DOCUMENT REVISION HISTORY

Revision Level & Date	Section/Figure/Entry	Correction
DS80000786C (12-04-18)	Module 9.	Added new errata.
	Module: "PTP messages get dropped in PTP 2-Step Mode"	Removed errata from document.
DS80000786B (08-17-18)	Modules 7. , 8.	Added new errata.
DS80000786A (04-05-18)	All	Initial release.

THE MICROCHIP WEB SITE

Microchip provides online support via our WWW site at www.microchip.com. This web site is used as a means to make files and information easily available to customers. Accessible by using your favorite Internet browser, the web site contains the following information:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQ), technical support requests, online discussion groups, Microchip consultant program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

CUSTOMER CHANGE NOTIFICATION SERVICE

Microchip's customer notification service helps keep customers current on Microchip products. Subscribers will receive e-mail notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, access the Microchip web site at www.microchip.com. Under "Support", click on "Customer Change Notification" and follow the registration instructions.

CUSTOMER SUPPORT

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Field Application Engineer (FAE)
- Technical Support

Customers should contact their distributor, representative or Field Application Engineer (FAE) for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in the back of this document.

Technical support is available through the web site at: <http://microchip.com/support>

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, AnyRate, AVR, AVR logo, AVR Freaks, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, Helder, JukeBlox, KeeLoq, Klear, LANCheck, LINK MD, maXStylus, maXTouch, MediaLB, megaAVR, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, Prochip Designer, QTouch, SAM-BA, SpyNIC, SST, SST Logo, SuperFlash, tinyAVR, UNI/O, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, EtherSynch, Hyper Speed Control, HyperLight Load, IntelliMOS, mTouch, Precision Edge, and Quiet-Wire are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2018, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 9781522439356

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
= ISO/TS 16949 =

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC
Tel: 919-844-7510

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto
Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-67-3636

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820