





# ASSEMBLY INSTRUCTION

## NC\*FXX & NC\*MXX | XLR Cable Connector


(A)

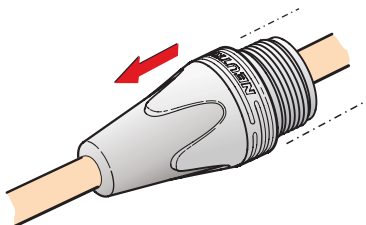


(B)

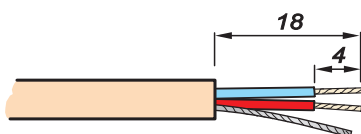


(C)

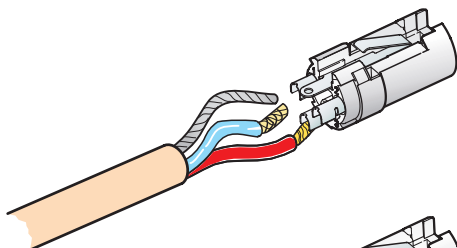


(D)

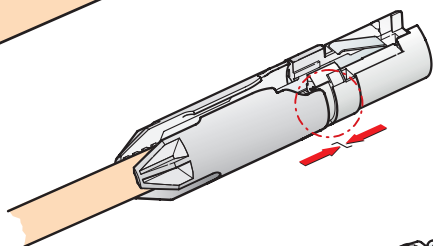

(E)

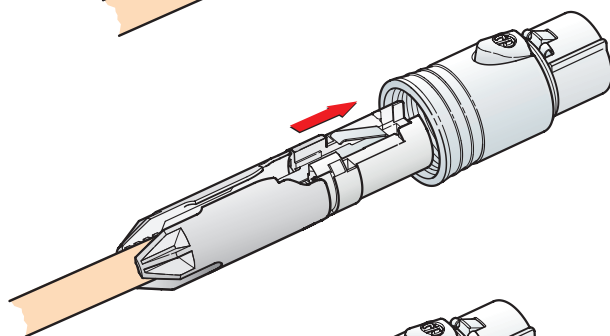

(F)

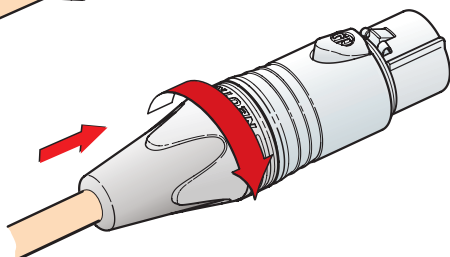

(A) Slide the boot onto the cable.

(B) Prepare cable as shown.

(C) Insert wires into the terminals and solder them.

(D) Put chuck onto the cable.  
**Attention: Pay attention to the guiding key.**

(E) Slide insert and chuck together into the housing.


(F) Finish the installation by turning the bushing onto the connector.

### ORDER OF ASSEMBLY

#### NC\*FXX



bushing



chuck




insert



housing

#### NC\*MXX



NEUTRIK AG  
NEUTRIK Zürich AG  
NEUTRIK USA Inc.  
NEUTRIK (UK) Ltd.

LI  
CH  
USA  
UK

T: +423 / 237 24 24  
T: +41 44 / 736 5010  
T: +1 732 / 901 9488  
T: +44 1983 / 811 441

F: +423 / 232 53 93  
F: +41 44 / 736 5011  
F: +1 732 / 901 9608  
F: +44 1983 / 811 439

NEUTRIK Vertriebs GmbH  
NEUTRIK France  
NEUTRIK Tokyo Ltd.  
NEUTRIK Hong Kong Ltd.

DE/NL/AT  
FR  
JP  
HK

T: +49 8131 / 280 890  
T: +33 1 / 4131 6750  
T: +81 3 / 3663 4733  
T: +852 / 2687 6055

F: +49 8131 / 280 830  
F: +33 1 / 4131 0511  
F: +81 3 / 3663 4796  
F: +852 / 2687 6052

Draft. Nr.: BDA 158 / 3102M1381 | Update: 12..03.2008 | Data subject to change without prior notice. ©2008NEUTRIK®. ALL RIGHTS RESERVED.

[www.neutrik.com](http://www.neutrik.com)

**NEUTRIK**