
Reset

This section of the manual contains the following major topics:

1.0	Introduction	2
2.0	Register Map.....	4
3.0	System Reset.....	7
4.0	Using the RCON Status Bits	11
5.0	Special Function Register Reset States	11
6.0	Design Tips	12
7.0	Related Application Notes	13
8.0	Revision History	14

dsPIC33/PIC24 Family Reference Manual

Note: This family reference manual section is meant to serve as a complement to device data sheets. Depending on the device variant, this manual section may not apply to all dsPIC33/PIC24 devices.

Please consult the note at the beginning of the “**Reset**” chapter in the current device data sheet to check whether this document supports the device you are using.

Device data sheets and family reference manual sections are available for download from the Microchip Worldwide Web site at: <http://www.microchip.com>

1.0 INTRODUCTION

The Reset module combines all the reset sources and controls the device Master Reset Signal, SYSRST. The following is a list of device Reset sources:

- POR: Power-on Reset
- BOR: Brown-out Reset
- MCLR: Master Clear Pin Reset
- SWR: RESET Instruction
- WDTO: Watchdog Time-out Reset
- CM: Configuration Mismatch Reset
(This source is not available on all devices. Refer to the specific device data sheet for details.)
- TRAPR: Trap Conflict Reset
- IOPUWR: Illegal Condition Device Reset
 - Illegal Opcode Reset
 - Uninitialized W Register Reset
 - Security Reset


A simplified block diagram of the Reset module is shown in [Figure 1-1](#). Any active source of reset will make the SYSRST signal active. On system Reset, some of the registers associated with the CPU and peripherals are forced to a known Reset state, while some are unaffected.

Note: Refer to the specific peripheral section or “**CPU**” (DS70359) in the “*dsPIC33/PIC24 Family Reference Manual*” for register Reset states.

All device Reset types set a corresponding status bit in the RCON register to indicate the type of Reset (see [Register 2-1](#)). A POR clears all bits except for the POR and BOR bits (RCON<1:0>); the POR and BOR bits are set. The user application can set or clear any bit at any time during code execution. The RCON bits only serve as status bits. Setting a particular Reset status bit in software will not cause a device Reset.

The RCON register also contains bits associated with the Watchdog Timer (WDT) and device power-saving states. For more information, refer to “**Watchdog Timer and Power-Saving Modes**” (DS70615).

Figure 1-1: Reset System Block Diagram

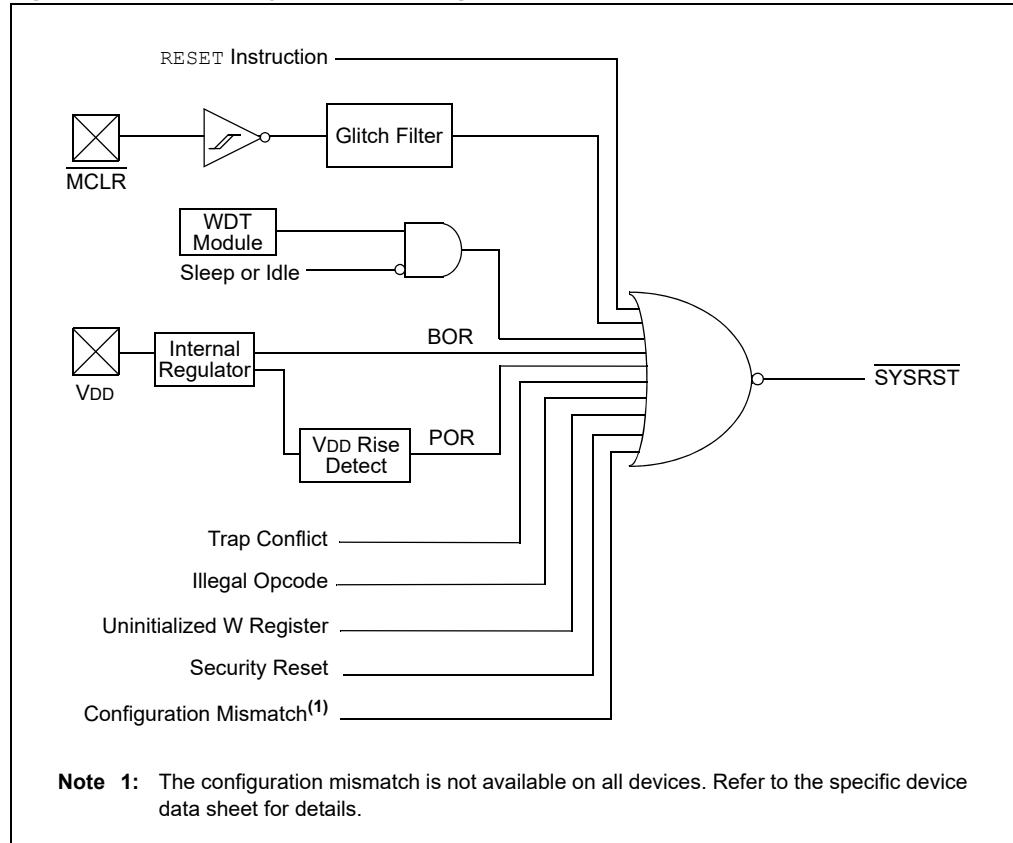

2.0 REGISTER MAP

Table 2-1 maps the bit functions for the RCON register.

Table 2-1: Reset Control Register Map

SFR Name	Bit 15	Bit 14	Bit 13	Bit 12	Bit 11	Bit 10	Bit 9	Bit 8	Bit 7	Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	All Resets
RCON	TRAPR	IOPUWR	—	—	VREGSF	—	CM	VREGS	EXTR	SWR	SWDTEN	WDTO	SLEEP	IDLE	BOR	POR	0003

Legend: — = unimplemented, read as '0'. Reset values are shown in hexadecimal.

Reset Module

Register 2-1: RCON: Reset Control Register⁽¹⁾

R/W-0	R/W-0	U-0	U-0	R/W-0	U-0	R/W-0	R/W-0
TRAPR	IOPUWR	—	—	VREGSF	—	CM ⁽²⁾	VREGS
bit 15							bit 8

R/W-0	R/W-0	R/W-0	R/W-0	R/W-0	R/W-0	R/W-1	R/W-1
EXTR	SWR	SWDTEN ⁽³⁾	WDTO	SLEEP	IDLE	BOR	POR
bit 7							bit 0

Legend:

R = Readable bit

W = Writable bit

U = Unimplemented bit, read as '0'

-n = Value at POR

'1' = Bit is set

'0' = Bit is cleared

x = Bit is unknown

- bit 15 **TRAPR:** Trap Reset Flag bit
1 = A Trap Conflict Reset has occurred
0 = A Trap Conflict Reset has not occurred
- bit 14 **IOPUWR:** Illegal Opcode or Uninitialized W Access Reset Flag bit
1 = An illegal opcode detection, an illegal address mode or an uninitialized W register used as an Address Pointer caused a Reset
0 = An illegal opcode or uninitialized W register Reset has not occurred
- bit 13-12 **Unimplemented:** Read as '0'
- bit 11 **VREGSF:** Flash Voltage Regulator Stand-by During Sleep bit
1 = Flash voltage regulator is active during Sleep
0 = Flash voltage regulator goes into Stand-by mode during Sleep
- bit 10 **Unimplemented:** Read as '0'
- bit 9 **CM:** Configuration Mismatch Flag bit⁽²⁾
1 = A configuration mismatch Reset has occurred
0 = A configuration mismatch Reset has not occurred
- bit 8 **VREGS:** Voltage Regulator Stand-by During Sleep bit
1 = Voltage regulator is active during Sleep
0 = Voltage regulator goes into Stand-by mode during Sleep
- bit 7 **EXTR:** External Reset Pin bit
1 = A Master Clear (pin) Reset has occurred
0 = A Master Clear (pin) Reset has not occurred
- bit 6 **SWR:** Software Reset (Instruction) Flag bit
1 = A RESET instruction has been executed
0 = A RESET instruction has not been executed
- bit 5 **SWDTEN:** Software Enable/Disable of WDT bit⁽³⁾
1 = WDT is enabled
0 = WDT is disabled
- bit 4 **WDTO:** Watchdog Time-out Flag bit
1 = WDT time-out has occurred
0 = WDT time-out has not occurred

Note 1: All of the Reset status bits can be set or cleared in software. Setting one of these bits in software does not cause a device Reset.

2: The configuration mismatch Reset flag is not available on all devices. (Refer to the specific device data sheet.)

3: If the FWDTEN Configuration bit is '1' (unprogrammed), the WDT is always enabled, regardless of the SWDTEN bit setting.

dsPIC33/PIC24 Family Reference Manual

Register 2-1: RCON: Reset Control Register⁽¹⁾ (Continued)

bit 3	SLEEP: Wake-up from Sleep Flag bit 1 = Device has been in Sleep mode 0 = Device has not been in Sleep mode
bit 2	IDLE: Wake-up from Idle Flag bit 1 = Device was in Idle mode 0 = Device was not in Idle mode
bit 1	BOR: Brown-out Reset Flag bit 1 = A Brown-out Reset or Power-on Reset has occurred 0 = A Brown-out Reset has not occurred
bit 0	POR: Power-on Reset Flag bit 1 = A Power-on Reset has occurred 0 = A Power-on Reset has not occurred

- Note 1:** All of the Reset status bits can be set or cleared in software. Setting one of these bits in software does not cause a device Reset.
- 2:** The configuration mismatch Reset flag is not available on all devices. (Refer to the specific device data sheet.)
- 3:** If the FWDTEN Configuration bit is '1' (unprogrammed), the WDT is always enabled, regardless of the SWDTEN bit setting.

3.0 SYSTEM RESET

The dsPIC33/PIC24 family of devices have two types of Reset: cold Reset and warm Reset.

On a cold Reset, the FNOSC configuration bits in the FOSC device configuration register select the device clock source.

The BOR, MCLR, WDT, SWR and IOPUWR all execute a cold Reset instead of a warm Reset. On a warm Reset, the device will continue to operate from the current clock source as indicated by the Current Oscillator Selection bits (COSC<2:0>) in the Oscillator Control register (OSCCON<14:12>).

The device is kept in a Reset state until the system power supplies have stabilized at appropriate levels and the oscillator clock is ready. Refer to “**Oscillator**” (DS70580) for more information.

When the oscillator clock is ready, the processor begins execution from location 0x000000. The user application programs a GOTO instruction at the Reset address, which redirects program execution to the appropriate start-up routine.

The Fail-Safe Clock Monitor (FSCM), if enabled, begins to monitor the system clock when the system clock is ready and the delay TFSCM has elapsed.

Table 3-1: Oscillator Delay^(1,2,3)

Oscillator Mode	Oscillator Startup Delay	Oscillator Startup Timer	PLL Lock Time	Total Oscillator Delay
FRC	TOSCD	—	—	TOSCD
FRCDIV16	TOSCD	—	—	TOSCD
FRCDIVN	TOSCD	—	—	TOSCD
FRCPLL	TOSCD	—	TLOCK	TOSCD + TLOCK
XT	TOSCD	TOST	—	TOSCD + TOST
HS	TOSCD	TOST	—	TOSCD + TOST
EC	—	—	—	—
XTPLL	TOSCD	TOST	TLOCK	TOSCD + TOST + TLOCK
HSPLL	TOSCD	TOST	TLOCK	TOSCD + TOST + TLOCK
ECPLL	—	—	TLOCK	TLOCK
SOSC	TOSCD	TOST	—	TOSCD + TOST
LPRC	TOSCD	—	—	TOSCD

Note 1: TOSCD = Oscillator Start-up Delay. Crystal Oscillator start-up times vary with crystal characteristics, load capacitance, and so on. Refer to the “**Electrical Characteristic**” chapter of the specific device data sheet for TOSCD specifications when using the internal FRC or internal LPRC oscillator.

2: TOST = Oscillator Start-up Timer Delay (1024 oscillator clock periods). For example, TOST = 102.4 μ s for a 10 MHz crystal and TOST = 32 ms for a 32 kHz crystal.

3: TLOCK = PLL lock time, if the PLL is enabled. Refer to the “**Electrical Characteristic**” chapter of the specific device data sheet for TLOCK specifications.

Note: When the device exits the Reset condition (begins normal operation), the device operating parameters (voltage, frequency, temperature, etc.) must be within their operating ranges, otherwise the device may not function correctly. The user application must ensure that the delay between the time at which the power is first applied and the time when the device comes out of Reset is long enough to get all operating parameters within specification.

3.1 Power-on Reset (POR)

A Power-on Reset (POR) circuit ensures the device is Reset from power-on. The POR circuit is active until VDD crosses the VPOR threshold and the power-up delay, TPU, has elapsed. The delay TPU ensures the internal device bias circuits become stable.

The device supply voltage characteristics must meet the specified starting voltage and rise rate requirements to generate the POR. Refer to the “**Electrical Characteristics**” chapter of the specific device data sheet for details.

In addition to TPU and TOST/TPWRT (if applicable), a NVM power-up delay, TNPD, is incurred before code execution begins.

The Power-on Reset status bit (POR) in the Reset Control (RCON<0>) register is set to indicate the Power-on Reset.

The device start-up time line and POR timing characteristics are described in the “**Electrical Characteristics**” chapter of the specific device data sheet.

3.2 Brown-out Reset (BOR) and Power-up Timer (PWRT)

The on-chip regulator has a Brown-out Reset (BOR) circuit that resets the device when the VDD is too low ($VDD < VBOR$) for proper device operation. The BOR circuit keeps the device in Reset until VDD crosses the VBOR threshold. Refer to the “**Electrical Characteristics**” chapter of the specific device data sheet for the minimum BOR pulse width (TBOR) specifications.

The Brown-out Reset status bit (BOR) in the Reset Control register (RCON<1>) is set to indicate the Brown-out Reset.

The device will not run at full speed after a BOR as the VDD must rise to acceptable levels for full-speed operation. The Power-up Timer (PWRT) provides a power-up timer delay (TPWRT) to ensure that the system power supplies have stabilized at the appropriate levels for full-speed operation before the device comes out of Reset.

3.3 External Reset (EXTR)

The External Reset is generated by driving the $\overline{MCLR}$ pin low. The $\overline{MCLR}$ pin is a Schmitt trigger input with an additional glitch filter. Reset pulses that are longer than the minimum pulse-width will generate a Reset. Refer to the “**Electrical Characteristics**” chapter of the specific device data sheet for minimum MCLR pulse width specifications (TMCLR). The External Reset Pin bit (EXTR) in the Reset Control register (RCON<7>) is set to indicate the MCLR Reset.

Many systems have external supervisory circuits that generate Reset signals to reset multiple devices in the system. This external Reset signal can be directly connected to the MCLR pin to reset the device when the rest of the system is Reset.

When using other sources to Reset the device, the external Reset pin ($\overline{MCLR}$) should be tied directly or resistively to VDD. In this case, the MCLR pin will not be used to generate a Reset. The external Reset pin (MCLR) does not have an internal pull-up and must not be left unconnected.

3.4 Software RESET Instruction (SWR)

Whenever the RESET instruction is executed, the device will enter a warm Reset state. This Reset state will reinitialize the clock. The clock source will be chosen by the FNOSC configuration bits in the FOSC register.

The Software Reset (Instruction) Flag bit (SWR) in the Reset Control register (RCON<6>) is set to indicate the software Reset.

3.5 Watchdog Time-out Reset (WDTO)

WDTO executes a cold Reset, which means the clock source is based on the FNOSC configuration bits on Reset. See [Section 3.0 “System Reset”](#) for more information. Whenever a Watchdog Time-out occurs, the device will asynchronously assert SYSRST. A WDT Time-out during Sleep or Idle mode will wake-up the processor, but will not reset the processor.

The Watchdog Time-out Flag bit (WDTO) in the Reset Control register (RCON<4>) is set to indicate the Watchdog Reset. Refer to “**Watchdog Timer and Power-Saving Modes**” (DS70615) for more information on Watchdog Time-out Reset.

3.6 Trap Conflict Reset

If a lower-priority hard trap occurs while a higher-priority trap is being processed, a hard trap conflict Reset occurs. The hard traps include exceptions of priority level 13 through level 15, inclusive. The address error and oscillator error traps fall into this category.

The Trap Reset Flag bit (TRAPR) in the Reset Control register (RCON<15>) is set to indicate the Trap Conflict Reset. Refer to “**Interrupts**” (DS70600) for more information on Trap Conflict Reset.

3.7 Configuration Mismatch Reset

To maintain the integrity of the peripheral pin select control registers, they are constantly monitored with shadow registers in hardware. If an unexpected change occurs in any of the registers (such as cell disturbances caused by ESD or other external events), a Configuration Mismatch Reset occurs.

The Configuration Mismatch Flag bit (CM) in the Reset Control register (RCON<9>) is set to indicate the Configuration Mismatch Reset. Refer to “**I/O Ports**” (DS70598) for more information on the Configuration Mismatch Reset.

Note: The configuration mismatch feature and associated Reset flag are not available on all devices. (Refer to the specific device data sheet.)
--

3.8 Illegal Condition Device Reset

An illegal condition device Reset occurs due to the following sources:

- Illegal Opcode Reset
- Uninitialized W Register Reset
- Security Reset

The Illegal Opcode or Uninitialized W Access Reset Flag bit (IOPUWR) in the Reset Control register (RCON<14>) is set to indicate the illegal condition device Reset.

3.8.1 ILLEGAL OPCODE RESET

A device Reset is generated if the device attempts to execute an illegal opcode value that is fetched from the program memory.

The illegal opcode Reset function can prevent the device from executing program memory sections that are used to store constant data. To take advantage of the illegal opcode Reset, use only the lower 16 bits of each program memory section to store the data values. The upper 8 bits should be programmed with 0x3F, which is an illegal opcode value.

3.8.2 UNINITIALIZED W REGISTER RESET

Any attempts to use the uninitialized W register as an address pointer will reset the device. The W register array (with the exception of W15) is cleared during all Resets and is considered uninitialized until it is written to.

dsPIC33/PIC24 Family Reference Manual

3.8.3 SECURITY RESET

If a Program Flow Change (PFC) or Vector Flow Change (VFC) targets a restricted location in a protected segment (Boot and Secure Segment), that operation will cause a security Reset.

The PFC occurs when the Program Counter is reloaded as a result of a Call, Jump, Computed Jump, Return, Return from Subroutine, or other form of branch instruction.

The VFC occurs when the Program Counter is reloaded with an Interrupt or Trap vector.

Refer to “**CodeGuard™ Security**” (DS70634) for more information on Security Reset.

- | |
|--|
| <p>Note 1: If a POR or BOR event occurs while a Run-Time Self-Programming (RTSP) erase or programming operation is in progress, the RTSP operation is aborted immediately. The user should execute the RTSP operation again after the device comes out of Reset.</p> <p>2: If an EXTR, SWR, WDTO, TRAPR, CM, or IOPUWR Reset event occurs while an RTSP erase or programming operation is in progress, the device will be Reset only after the RTSP operation is complete.</p> |
|--|

4.0 USING THE RCON STATUS BITS

The user application can read the Reset Control register (RCON) after any device Reset to determine the cause of the Reset.

Note: The status bits in the RCON register should be cleared after they are read so that the next RCON register value after a device Reset will be meaningful.

Table 4-1 provides a summary of the Reset flag bit operation.

Table 4-1: Reset Flag Bit Operation

Flag Bit	Set by:	Cleared by:
TRAPR (RCON<15>)	Trap conflict event	POR, BOR
IOPWR (RCON<14>)	Illegal opcode or uninitialized W register access or Security Reset	POR, BOR
CM (RCON<9>)	Configuration Mismatch	POR, BOR
EXTR (RCON<7>)	MCLR Reset	POR
SWR (RCON<6>)	RESET instruction	POR, BOR
WDTO (RCON<4>)	WDT Time-out	PWRSV instruction, CLRWDI instruction, POR, BOR
SLEEP (RCON<3>)	PWRSV #SLEEP instruction	POR, BOR
IDLE (RCON<2>)	PWRSV #IDLE instruction	POR, BOR
BOR (RCON<1>)	POR, BOR	—
POR (RCON<0>)	POR	—

Note: All Reset flag bits can be set or cleared by the user software.

5.0 SPECIAL FUNCTION REGISTER RESET STATES

Most of the Special Function Registers (SFRs) associated with the dsPIC33/PIC24 CPU and peripherals are reset to a particular value at a device Reset. The SFRs are grouped by their peripheral or CPU function and their Reset values are specified in the appropriate sections of this manual.

The Reset value for each SFR does not depend on the type of Reset, with the exception of seven registers. The Reset value for the Reset Control register, RCON, will depend on the type of device Reset. The Reset value for the Oscillator Control register, OSCCON, will depend on the type of Reset and the programmed values of the oscillator configuration bits in the FOSC Device Configuration register. In addition, the oscillator SFRs (OSCCON, CLKDIV, PLLFBD, OSCTUN, ACLKCONx and ACLKDIVx) are reset only at POR.

Note: Not all SFRs are available on all devices. Refer to the specific device data sheet for more information.

dsPIC33/PIC24 Family Reference Manual

6.0 DESIGN TIPS

Question 1: *How do I use the RCON register?*

Answer: The initialization code after a device Reset should examine the RCON register and confirm the source of the Reset. In certain applications, this information can be used to take appropriate action to correct the problem that caused the Reset to occur. All Reset status bits in the RCON register should be cleared after reading them to ensure the RCON value will provide meaningful results after the next device Reset.

Question 2: *The BOR module does not have the programmable trip points that my application needs. How can I work around this?*

Answer: The BOR circuitry is used to avoid violation of the V/F specification of the device. In many devices, the minimum voltage for full-speed operation is much higher than in dsPIC33/PIC24 devices. Therefore, in such devices, a programmable BOR circuit is needed to provide the multiple speed option. However, the dsPIC33/PIC24 devices support full-speed operation at a much lower voltage, so the simple BOR module is enough. If the device operating voltage drops to a value where full-speed operation is not possible, then BOR is asserted. If the device is in a non-BOR state, then full-speed operation is valid.

Question 3: *I initialized a W register with a 16-bit address, but the device appears to reset when I attempt to use the register as an address.*

Answer: Because all data addresses are 16-bit values, the uninitialized W register logic only recognizes that a register has been initialized correctly if it was subjected to a word load. Two-byte moves to a W register, even if successive, will not work, resulting in a device Reset if the W register is used as an address pointer in an operation.

7.0 RELATED APPLICATION NOTES

This section lists application notes that are related to this section of the manual. These application notes may not be written specifically for the dsPIC33/PIC24 product family, but the concepts are pertinent and could be used with modification and possible limitations. The current application notes related to the Reset Module module include the following:

Title	Application Note #
Power-up Trouble Shooting	AN607
Power-up Considerations	AN522

Note: Please visit the Microchip web site (www.microchip.com) for additional Application Notes and code examples for the dsPIC33/PIC24 family of devices.

dsPIC33/PIC24 Family Reference Manual

8.0 REVISION HISTORY

Revision A (July 2009)

This is the initial released version of this document.

Revision B (December 2010)

This revision includes the following updates:

- Added a note at the beginning of the section, which provides information on complementary documentation
- Updated the dsPIC33E references in the entire document as dsPIC33E/PIC24E.
- Added Security Reset to the Reset System Block Diagram (see [Figure 1-1](#))
- Added Note 4 and the VREGSF bit to the Reset Control Register (see [Register 2-1](#))
- Updated the third paragraph (removed numbered references) in [Section 3.0 “System Reset”](#)
- Updated Note1 and Note 3 in Oscillator Delay (see [Table 3-1](#))
- Removed the System Reset Timing diagram
- Updated all paragraphs of [Section 3.1 “Power-on Reset \(POR\)”](#)
- Updated the first and second paragraphs, removed the last paragraph, and removed the Brown-out Scenarios diagram in [Section 3.2 “Brown-out Reset \(BOR\) and Power-up Timer \(PWRT\)”](#)
- Added Note 1 and Note 2 to [Section 3.8.3 “Security Reset”](#)
- Removed 8.4 “Device Start-up Time Lines”
- Updated the last paragraph of [Section 5.0 “Special Function Register Reset States”](#)
- Added the VREGSF bit to the Reset Control Register Map (see [Table 2-1](#))
- Updates to formatting and minor text changes have been incorporated throughout the document

Revision C (February 2023)

This revision includes the following updates:

- Applied current Family Reference Manual format.
- Moved register summary above the RCON register.
- Removed the SBOREN bit from the RCON register.
- Updated all dsPIC33E/PIC24E references to dsPIC/PIC24.
- Updated [Section 3.0 “System Reset”](#), [Section 3.2 “Brown-out Reset \(BOR\) and Power-up Timer \(PWRT\)”](#), [Section 3.4 “Software RESET Instruction \(SWR\)”](#), [Section 3.5 “Watchdog Time-out Reset \(WDTO\)”](#), [Section 3.6 “Trap Conflict Reset”](#) and [Section 5.0 “Special Function Register Reset States”](#).

Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
 - Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
 - Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
 - Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable" Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.
-

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at <https://www.microchip.com/en-us/support/design-help/client-support-services>.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maxStylus, maxTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, TrueTime, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, Clockstudio, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, GridTime, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, IntelliMOS, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, KoD, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, Trusted Time, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2010-2023, Microchip Technology Incorporated and its subsidiaries.

All Rights Reserved.

ISBN: 978-1-6683-1886-7

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC
Tel: 919-844-7510

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto
Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4485-5910
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820