

PART NUMBER CREATOR

for Combination with no signal contacts

Arrangements which accept only the #8 sized contacts are: **2W2C, 3W3, 3W3C, 5W5 and 8W8**
The available #8 size contacts include:


- Power with current ratings from 10 thru 40 amps
- Coax in 50 or 75 ohms
- High Voltage with plastic bodies for ratings up to 2,8 kV

The connectors are available:

with NO contacts at all



factory pre-loaded

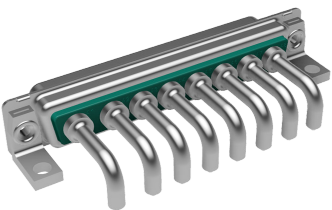

Included configurations are:

- No hardware, flange has thru holes, typically used in a hood for the cable end
- Flange threads in 4-40 or M3
- Standoffs for straight PCB mounting with or without boardlock clips
- Right angle bracket with mounting hole locations in accordance with the footprint chosen

The Part Number Creator for these arrangements includes over 2500 choices.
Configurations and hardware choices are all "coded" using the Part Number Creator.

Here are some examples of "coding" for some popular ones, to help you to create your own:

1. Please note that some hardware choices are optimized for a specific PCB thickness
2. Power and Coax Contacts are available in 2 quality classes


Example: 2W2 female, with 20 amp solder cup for a cable end:

302W2CSXX42A10X




Example: 8W8 female, right angle with coax contacts, brackets with boardlocks:

3008W8SXX88N40X

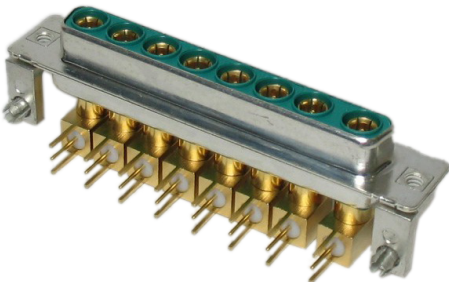

Example: 5W5 straight, PCB power contacts, standoffs:

3005W5SXX51E20X

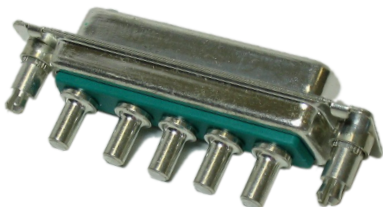

PART NUMBER CREATOR

for Combination with no signal contacts

3 003W3 S X X 6 1 A 1 0 X

Product Line	
3	= Shell steel tin plated
1	= Brass tin plated*
5	= Shell yellow chromated* (not RoHS compliant)
A	= Stainless steel*
*on request	
Shell size and design	
1	= 2W2C
2	= 3W3, 3W3C
3	= 5W5
4	= 8W8
Empty positions ADD „0“ = 003W3	
Contact type	
P	= Plug connector
S	= Socket connector
X	= Crimp and 3W3, 5W5, 8W8, 2W2C, 3W3C (no contacts are supplied with the connector)
*on request	
Termination only for no SIGNAL contacts	
X	= 3W3, 5W5, 8W8, 2W2C, 3W3C
Termination for HIGH POWER- or COAXIAL contacts	
Quality class 3 / Quality class 1	
C1	= Solder/Crimp angled 10 A
C2	= Solder/Crimp angled 20 A
C3	= Solder/Crimp angled 30 A
C4	= Solder/Crimp angled 40 A
F2,61/F1,41	= Solder cup 10 A
F4,62/F3,42	= Solder cup 20 A
F6,63/F5,43	= Solder cup 30 A
F8,64/F7,44	= Solder cup 40 A
68/48	= Solder pin, straight 20 A, D= .077"/1.95 mm
69/49	= Solder pin, straight 20 A, D= .102"/2.60 mm
70/50	= Solder pin, straight 20 A, D= .110"/2.85 mm
71/51	= Solder pin, straight 30 A, D= .130"/3.18 mm
72/52	= Solder pin, straight 40 A, D= .150"/3.75 mm
Quality class 3 / Quality class 1	
59/55	= Solder pin, angled 15 A
73/56	= Solder pin, angled 20 A
74/57	= Solder pin, angled 30 A
75/58	= Solder pin, angled 40 A
77/60	= Solder pin, angled 40 A
81/66	= Solder pin, angled 20 A
82/67	= Solder pin, angled 30 A
85/65	= Solder pin, angled 30 A
G7/76	= 3 Solder pins Straight 50 Ω
G9/78	= 3 Solder pins angled 50 Ω
H1/79	= 3 Solder pins angled 50 Ω
H4/80	= 5 Solder pins angled 50 Ω
G8/86	= 3 Solder pins Straight 75 Ω
Quality class 3 / Quality class 1	
H2/88	= 3 Solder pins angled 75 Ω
H3/89	= 3 Solder pins angled 75 Ω
H5/90	= 5 Solder pins angled 75 Ω
91	= Screw termination 20 A
/P1	= press fit 30A
/P2	= press fit 30A
/P4	= press fit 30A
99	= no high power, coax or crimp contacts loaded Coaxial contacts with cable termination must be ordered separately.
Mounting style	
A1	= Riveted
A2	= M3 threaded insert
A3	= 440 UNC threaded insert
A4	= M3 threaded rear spacer
A5	= 440 UNC threaded rear spacer
A6	= Float fastening
A7	= Threaded rear spacer for M3 press fit
A8	= Threaded rear spacer for 440 UNC press fit
C1	= M3 threaded rear spacer with PCB clip, PCB .063"/1.60 mm
C2	= 440 UNC threaded rear spacer with PCB clip, PCB .063"/1.60 mm
C3	= M3 threaded rear spacer with PCB clip, PCB .091"/2.30 mm
C4	= 440 UNC threaded rear spacer with PCB clip, PCB .091"/2.30 mm
C5	= M3 threaded rear spacer with PCB clip, PCB .126"/3.20 mm
C6	= 440 UNC Threaded rear spacer with PCB clip, PCB .126"/3.20 mm
D1	= M3 clip and threaded rear spacer with PCB clip, PCB .063"/1.60 mm
D2	= 440 UNC clip and threaded rear spacer with PCB clip, PCB .063"/1.60 mm
D3	= M3 clip and threaded rear spacer with PCB clip, PCB .091"/2.30 mm
D4	= 440 UNC clip and threaded rear spacer clip, PCB .091"/2.30 mm
D5	= M3 clip and threaded rear spacer with PCB clip, PCB .126"/3.20 mm
D6	= 440 UNC clip and threaded rear spacer with PCB clip, PCB .126"/3.20 mm
E1	= M3 threaded rear spacer with PCB clip, PCB .063"/1.60 mm
E2	= 440 UNC threaded rear spacer with PCB clip, PCB .063"/1.60 mm
E3	= M3 threaded rear spacer with PCB clip, PCB .091"/2.30 mm
E4	= 440 UNC threaded rear spacer with PCB clip, PCB .091"/2.30 mm
E5	= M3 threaded rear spacer with PCB clip, PCB .126"/3.20 mm
E6	= 440 UNC threaded rear spacer with PCB clip, PCB .126"/3.20 mm
F1	= M3 clip and threaded rear spacer with PCB clip, PCB .063"/1.60 mm
F2	= 440 UNC clip and threaded rear spacer with PCB clip, PCB .063"/1.60 mm
F3	= M3 clip and threaded rear spacer with PCB clip, PCB .091"/2.30 mm
F4	= 440 UNC clip and threaded rear spacer with PCB clip, PCB .091"/2.30 mm
F5	= M3 clip and threaded rear spacer with PCB clip, PCB .126"/3.20 mm
F6	= 440 UNC clip and threaded rear spacer with PCB clip, PCB .126"/3.20 mm
G1	= Metal bracket, M3 threaded insert for .370"/9.40 mm
G2	= Metal bracket, 440 UNC threaded insert for .370"/9.40 mm
G3	= Metal bracket, M3 threaded insert and clip for .370"/9.40 mm
G4	= Metal bracket, 440 UNC threaded insert and clip for .370"/9.40 mm
H1	= Metal bracket, M3 threaded lock for .370"/9.40 mm
H2	= Metal bracket, 440 UNC threaded lock for .370"/9.40 mm
H3	= Metal bracket, M3 threaded lock and clip for .370"/9.40 mm
H4	= Metal bracket, 440 UNC threaded lock and clip for .370"/9.40 mm
N1	= Metal bracket, M3 threaded insert for .280"/7.19 mm
N2	= Metal bracket, 440 UNC threaded insert for .280"/7.19 mm
N3	= Metal bracket, M3 threaded insert and clip for .280"/7.19 mm
N4	= Metal bracket, 440 UNC threaded insert and clip for .280"/7.19 mm
P1	= Metal bracket, M3 threaded lock for .280"/7.19 mm
P2	= Metal bracket, 440 UNC threaded lock for .280"/7.19 mm
P3	= Metal bracket, M3 threaded lock and clip for .280"/7.19 mm
P4	= Metal bracket, 440 UNC threaded lock and clip for .280"/7.19 mm
W1	= Threaded rear spacer with M3 press in pin
W2	= Threaded rear spacer with 440 UNC press in pin
OX = Standard	